

Technical Service Bulletin



90 Seat belt reminder light stays on

90 14 50 2035937/3 July 17, 2014. Supersedes Technical Service Bulletin Group 90 number 14-46 dated February 6, 2014 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A7	2012 - 2013	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised <i>Service</i> (Added additional repair scenario) Revised <i>Warranty</i> (Updated labor operations)
2	2/6/2014	Revised header data (Added model year) Revised <i>Service</i> (Updated SVM table)
1	12/3/2013	Initial publication

- The seatbelt warning light is illuminated, but the passenger seatbelt is buckled.
- The seatbelt warning chime is not on.
- This bulletin only applies to vehicles equipped with Radio plus (without Navigation).

Technical Background

Software of the instrument cluster control module needs to be updated.

Production Solution

New software in the instrument cluster control module, J285 (address word 17), addresses the condition.

Technical Service Bulletin



Service

For vehicles with software version 04XX:

1. Replace the instrument cluster control module, J285 (address word 17).
2. Check the software version of the instrument cluster control module, J285 (address word 17):
 - If the software version is at 0519, no additional steps are necessary.
 - If the software version is at 0500 - 0515, update the software using the *SVM Update Instructions* below.

For vehicles with software version 03XX or 05XX:

Update the instrument cluster control module, J285 (address word 17), software using the *SVM Update Instructions* below.

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *Software Version Management (SVM), operating instructions*.
2. Update the instrument cluster control module (J285) using the SVM action code as listed in the table below if necessary.

Model	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
A6,A7(MY12)	N/A	N/A	N/A	0377	17A013
A6,A7(MY13)	N/A	N/A	N/A	0519	17A013

Technical Service Bulletin



Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9025		
Damage Code:	0039		
Labor Operations:	Replace instrument cluster (if necessary)	9025 5500	70 TU
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 60 TU)
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2035937/3		

Required Parts and Tools

Part Number	Part Description	Quantity
4G8 920 XXX X	Instrument Cluster	1

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732: *Software Version Management (SVM), operating instructions.*

All part and service references provided in this TSB (2035937) are subject to change and/or removal. Always check with your Parts Dept. and service manuals for the latest information.