

Technical Service Bulletin



91 Parking aid system does not work (DTC 1549, 1626, 1627, 1628, and/or 1629)

91 14 31 2023006/3 April 7, 2014. Supersedes Technical Service Bulletin Group 91 number 11-08 dated August 22, 2011 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q5	2009 - 2016	All	Front parking aid

Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised title Revised header data (Added model years 2014 - 2016; added DTCs)
2	8/22/2011	Revised header data (Added model years 2012 and 2013)
1	3/23/2010	Original publication

- The parking aid system does not work.
- One or more of the following DTCs may be logged in parking aid control unit, J446 (address word 10), for disruption/short circuit to ground:
 - **DTC 1549** (Supply voltage for parking aid sensor)
 - **DTC 1626** (Right front parking aid sensor)
 - **DTC 1627** (Right front center parking aid sensor)
 - **DTC 1628** (Left front center parking aid sensor)
 - **DTC 1629** (Left front parking aid sensor)

Technical Background

The wire harness for the parking aid system may have been damaged when the front license plate frame was installed (Figure 1).



Figure 1. Damage to the wire harness for the parking aid system.

Production Solution

Not applicable.

Service

Repair the wire harness as necessary.

Warranty

This damage is due to outside influence and is not covered by any Audi warranty.

Additional Information

All parts and service references provided in this TSB (2023006) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.