

Technical Service Bulletin



94 Warning light for headlight range control on

94 14 47 2038030/2 August 7, 2014. Supersedes Technical Service Bulletin Group 94 number 14-46 dated August 4, 2014 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2013	N044298 - N999999 A227521 - A999999	Not Applicable
A5 Cabriolet	2013	014300 - 999999	Not Applicable
Q5	2013	080963 - 999999	PR code GP2

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header data (Extended applicable VIN range)
1	8/4/2014	Initial publication

- Customer reports that the warning light for headlight range control sporadically illuminates.
- No fault codes are found in the vehicle electrical system control module, J519 (address word 09).

Technical Background

A vehicle electrical system control module with a deviating component was installed in production.

Production Solution

Corrected vehicle electrical system control modules.

Service

1. Confirm that the *Condition* matches exactly and that the vehicle falls within the applicable VIN range of this bulletin.
2. Replace the vehicle electrical system control module (J519).

Technical Service Bulletin



Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9710		
Damage Code:	0040		
Labor Operations:	For Q5:		
	Vehicle electrical system ECM replace	9710 5550	30 TU
	Shelf under dash panel removed+reinstalled	6818 1900	40 TU
	2 Headlight assembly adjusted	9415 1600	20 TU
	For A4 and A5 Cabriolet:		
	Vehicle electrical system ECM replace	9710 5550	30 TU
	Shelf under dash panel removed+reinstalled	6818 1900	30 TU
	2 Headlight assembly adjusted	9415 1600	20 TU
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 100 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2038030/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Part Number	Part Description	Quantity
8K0907063DL	Vehicle electrical system control module	1

Technical Service Bulletin



Additional Information

All parts and service references provided in this TSB (2038030) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.