

94 Exterior lighting system error displayed on instrument cluster; no DTC

94 14 50 2038103/1 August 11, 2014.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment	
A3	2015	All	Not Applicable	

Condition

- The warning "exterior lighting system error" appears on the instrument cluster, but the condition can only sporadically be reproduced.
- All exterior lighting continues to operate normally.
- No DTCs are found in the vehicle electrical system control module, J519 (address word 09).

Technical Background

The calculation of the check sum of the J519 control module is incorrect, which causes the false warning on the instrument cluster.

Production Solution

Updated software version.

Service

SVM Update Instructions

- 1. Follow all instructions in TSB 2011732: 00 Software Version Management (SVM), operating instructions.
- 2. Update the J519 control module using the SVM action code as listed in the table below, if necessary.

Model	Old Software Version	New Software Version (or higher)	SVM Code Input
A3	124	134	09A015

^{© 2014} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Technical Service Bulletin

Warranty

Claim Type:Use applicable claim type. If vehicle is outside any warranty, this Technical Bulletin is informational only.					
Service Number:	9710				
Damage Code:	0039				
Labor Operations:	Software update	0151 0000	Time stated on diagnostic protocol (Max 100 TU)		
Diagnostic Time:	GFF	No allowance	ο τυ		
	Road test prior to service procedure	No allowance	0 TU		
	Road test after service procedure	No allowance	0 TU		
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Or	nline for DADP allowan	ce details)		
Claim Comment:	As per TSB #2038103/1				

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual.* Claims are subject to review or audit by Audi Warranty.

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

• TSB 2011732 00 Software Version Management (SVM), operating instructions.

All part and service references provided in this TSB (2038103) are subject to change and/or removal. Always check with your Parts Dept. and service manuals for the latest information.

© 2014 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.