

Technical Service Bulletin

24AD UPDATE – ECM Software Update (FED_EMS)

January 10, 2014

| Model(s) | Year | Affected Vehicles | Vehicle-Specific Equipment |
|---------------------------------------|-------------|---------------------------------------|----------------------------|
| A4, allroad, A5, A5 Cab, A6, Q5 | 2012 - 2014 | See Campaign/Action screen in ElsaWeb | None |

| REVISION HISTORY | | | | |
|------------------|------------------|--------------------------------------|--|--|
| Revision | Date | Purpose | | |
| 1 | October 22, 2013 | Original publication | | |
| 2 | January 10, 2014 | Additional steps added to procedure. | | |

Condition

This Update has been proactively released to prevent the following condition from occurring in the vehicle:

Under certain conditions, permanent mode \$0A DTC codes concerning the fuel pump power stage module may remain visible after the vehicle's OBD system has run the proper monitors successfully to allow the DTC to be erased by the system, after a proper repair. This software malfunction may cause vehicle to not pass IM inspection programs. This software update eliminates specific permanent DTC codes stored in mode \$0A of the ECM. All other DTC storage functions remain unaffected.

This Update is in effect until removed.

Vehicle must meet all of the following criteria:

- Procedure is valid only for vehicles that show the 24AD code in the ElsaWeb Campaign/Action Information screen on the day of repair.
- Vehicle must be within the Federal Emissions Warranty.
- Procedure must be performed within the allotted time frame stated in this Technical Service Bulletin.
- Procedure must be performed on applicable vehicles in dealer inventory prior to sale.

Technical Background

Under certain conditions, permanent mode \$0A DTC codes concerning the fuel pump power stage module may remain visible after the vehicle's OBD system has run the proper monitors successfully to allow the DTC to be erased by the system, after a proper repair. This software malfunction may cause vehicle to not pass IM inspection programs. This software update eliminates specific permanent DTC codes stored in mode \$0A of the ECM. All other DTC storage functions remain unaffected.

© 2014 Audi of America, Inc.

Page 1 of 4

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Service

SVM Update Instructions

- 1. Follow all instructions in TSB 2011732: 00 Software Version Management (SVM), operating instructions.
- 2. Using Audi Flashing, update the ECM, (J623), using the SVM action code as listed in the table below.
- 3. After flash is complete cycle the ignition.
- 4. Clear all DTCs.

Note: If the ignition is not cycled a DTC will set in the ECM that must be erased by GFF. The additional time to erase the DTC will not be covered under warranty.

| Old Software Part Number | Old Software Version | New Software Part Number | New Software Version (or higher) | SVM Action Code |
|-----------------------------|-------------------------|-----------------------------|--|-----------------|
| 8R1907115B | All | 8R1907115B | 0005 | |
| 4G0907115B 4G0907115F | All | 4G0907115F | 0004 | |
| 4G0907115H | All | 4G0907115H | 0003 | 24ADA001 |
| 8K5907115C | All | 8K5907115C | 0005 | |
| 8K5907115F | All | 8K5907115F | 0007 | |
| 8K5907115J | All | 8K5907115J | 0002 | |

Note: If the Bluetooth wireless VAS 5054A transmitter head is used in conjunction with a VAS tester, the transmitter head MUST BE connected with a USB cable to the tester.

Warning: The Bluetooth function of the scan tool MUST BE PHYSICALLY SWITCHED OFF prior to performing this update. See below:



VAS 6150 & VAS 6150A (Front panel behind handle)



VAS 6150B (Middle right side behind WIRELESS door)



VAS 6160/-VPC (Upper left side behind SC/EX door)

© 2014 Audi of America, Inc.

Page 2 of 4

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

Technical Service Bulletin



Warranty

| Update Time Requirements/ Reimbursement | | To ensure prompt and proper payment, be sure to immediately enter the applicable reimbursement code listed below upon completion of the repair work. Claims will be paid only for vehicles that show the 24AD code in the ElsaWeb Campaign/Action Information screen on the day of repair. | | | |
|---|-------------------|---|---------------------------------|----------|--|
| 24AD Saga | Claim Entry Pro | cedure | | | |
| Check ElsaV | Veb to determine | whether Update 24AD is open. | | | |
| Service No. | · 244D | | | | |
| Damage Co | | | | | |
| - | facturer - Remo | ved part: 002 | | | |
| Claim Type | | | | | |
| Sold vehicle | = 7 10 | | | | |
| Unsold vehic | cle = 7 90 | | | | |
| Saga Accou | Inting Instructio | ons | | | |
| Criteria ID | Repair operat | | Labor Operation Number | TU | |
| 01 | Check softwar | e level, no update required | 0183 0099 | 20 | |
| 01 | Check softwar | e level, update required | 2470 2599 | 30 | |
| | | | | | |
| There is no r | reimbursement fo | or vehicle wash or loaner vehicle. | | | |
| If the vehicl | e is outside of t | he specified warranty period, the custom | er has the option to pay for th | e repair | |
| If the custon | ner agrees to pay | r for the repair: | | | |
| | 0,1,1 | 754 5002 and provide VINL applicable Service | | | |

Fax the information to (248) 754-5093 and provide VIN, applicable Service Number, Customer Info, Dealer Number and Date.

© 2014 Audi of America, Inc.

Page 3 of 4

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Technical Service Bulletin

| Additional Actions | Some of the affected vehicles may be involved in additional Actions. Please check your ElsaWeb Campaign/Action Information screen so that any additional required work can be done simultaneously. |
|--------------------------------------|---|
| Update Verification | For verification, <i>always</i> check the ElsaWeb Campaign/Action Information screen. The ElsaWeb system is the <i>only</i> binding inquiry and verification system; other systems are not valid and <i>may result in non-payment</i> of a claim. |
| Help for Claim Input | For questions regarding claim input, contact the Warranty Helpline. |
| Required Customer Notification | Inform your customer in writing by recording on the Repair Order any and all work that was conducted on the vehicle, including any and all updates completed under this Update. |

Additional Information

All parts and service references provided in this Update are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

© 2014 Audi of America, Inc.

Page 4 of 4

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.