

Tech Tips

TT 17-14-01


Date: October 17, 2014

2014 Routan 3.6 Oil Pressure Light ON and P06DD is Stored

A change was made to the engine Oil Filter Adapter (OFA) for 2014 Model Year vehicles that resulted in a change in the oil filter element. It is important to note that the two different designs are **Not** interchangeable. Failure to install the correct oil filter **WILL** result in permanent engine damage.

- When replacing the filter, use only the o-ring included in the filter package. Failure to do so WILL result in leakage and possible Oil Filter Adapter damage.
- Also DTC P06DD will result due to incorrect filter application.

Please remove and inspect the oil filter for correct filter installed.

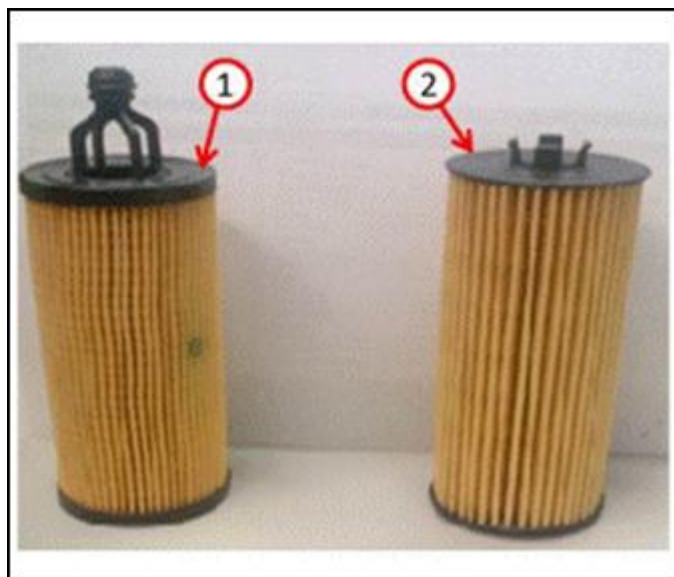

1 - 2014 Model Year and Later (P/N 7B0115562A).

2 - 2013 Model Year and Prior (P/N 7B0115562B).