



# Technical Bulletin

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
All	2008 - 2011	2.0T (CCTA,CBFA)	All	All	All

## Condition

24 14 01 September 4, 2014 2038161

### MIL ON, DTCs P2014 or P2015 Intake Manifold Faults Stored in ECM Fault Memory

MIL ON and 1 or more of the following fault codes stored in the ECM fault memory:

DTC	Description
P2014	Intake manifold runner position sensor / switch circuit
P2015	Intake manifold runner position sensor / switch circuit range / performance

## Technical Background

Failure of Intake manifold causing fault codes to be stored in the ECM.

## Production Solution

Improved intake manifold design.

## Service

1. Perform the Intake Manifold Limited Warranty Extension (see Repair Manual Group 24 Multiport Fuel Injection, Removal and Installation Intake Manifold with Fuel Rail in Elsa).
2. After performing Intake Manifold Limited Warranty Extension, add fuel additive G 001780M3 to the fuel tank. Also, refer the customer to brochure 2014 VW Top Tier Fuel (VWTOPTIERJAN14) and explain the benefits of using Top-Tier fuels as indicated in Technical Bulletin 2014815.



# Technical Bulletin

## Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual <sup>1)</sup>					
Model(s)	Year(s)	Eng. Code(s)	Trans. Code(s)	VIN Range From	VIN Range To
All	2008 - 2011	2.0T (CCTA,CBFA)	All	All	All
<b>SAGA Coding</b>					
Claim Type:			Use applicable Claim Type <sup>1)</sup>		
Service Number:	Damage Code	HST		Damage Location (Depends on Service No.)	
2447	0010	--		Use applicable when indicated in ElsaWeb (L/R)	
Parts Manufacturer	Tiguan, EOS, CC, Passat, Golf, GTI			WVO <sup>2)</sup>	
	Jetta			3ME <sup>2)</sup>	
Labor Operation <sup>3)</sup> : Remove and Install			24471920 = 160 TU		
Labor Operation <sup>3)</sup> : Intake Manifold Replace			24475570 = 40 TU		
Causal Part:			06J133185**		
<b>Diagnostic Time <sup>4)</sup></b>					
GFF Time expenditure	01500000 = 20 TU max.			YES	
Road Test	01210004 = 10 TU			YES	
Technical Diagnosis	01320000 = 00 TU max.			NO	
Claim Comment: Input "As per Technical Bulletin 2038161" in comment section of Warranty Claim.					
<sup>1)</sup> Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only <sup>2)</sup> Code per warranty vendor code policy. <sup>3)</sup> Labor Time Units (TUs) are subject to change with ELSA updates. <sup>4)</sup> Documentation required per Warranty Policies and Procedures Manual.					



# Technical Bulletin

## Required Parts and Tools

Part Description	Part Number	Quantity
Intake Manifold	06J 133 201 AS	1
Injector Cleaner	G 001780M3	1
2014 VW Top Tier Fuel Brochure	VWTOPTIERJAN14	1

Tool Description	Tool No:
Midtronics Battery Tester/Charger	InCharge 940 (INC-940) or GRX3000VAS
VAS Diagnostic Tool	VAS 6150/X & VAS 6160/X with ODIS Service with: current online updates

## Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.