



# Service Bulletin

File in Section: -

Bulletin No.: PIP5165A

Date: March, 2014

## PRELIMINARY INFORMATION

**Subject:** Oil Dripping Out Of The Air Filter Box

**Models:** 2014 Chevrolet Corvette  
With 6.2L LT1 with Option Z51 Dry Sump Engine W/Manual or Auto Trans

**This PI was superseded to update model list and recommendations. Please discard PIP5165.**

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

If the customer drives aggressively with low miles on the car it is possible to push oil through the PCV system. The second possible cause for the condition could be the oil level for the dry sump system was over filled.

### Recommendation/Instructions

No internal repairs are required.

Check oil level for dry sump system.

Please follow oil level procedure found in the Owner's Manual or SI.

If the oil level is found to be over filled, please make sure the service consultant reviews the oil check procedure with the owner.

Change the oil and filter.

Remove the air cleaner assembly.

Clean any oil out of the filter housing and duct.

Remove the MAF clean off any oil.

Make sure that there is no residual oil in the PVC lines.

Install a new air filter in the air box.

Reinstall the air box assembly.

### Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
4020390	Air Cleaner Assembly Replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.