



# Service Bulletin

File in Section: -

Bulletin No.: PIP5193

Date: April, 2014

## PRELIMINARY INFORMATION

**Subject:** Low Coolant Lamp Or Message On The DIC

**Models:** 2015 Chevrolet Silverado HD  
2015 GMC Sierra HD  
Built with a 6.6L RPO LML Diesel engine

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

The low coolant light and/or DIC message may come on with the coolant level at the correct level.

### Recommendation/Instructions

Check the following for a possible level sensor connection concern:

1. Reservoir connector loose/unplugged
2. Reservoir connector wires broken at the connector, terminals uncrimped or wires pulled from the terminal at the connector
3. Reservoir connector wire terminals bent in the connector

If the sensor connection and terminals are okay follow any SI documents that pertain to this concern.

### Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.