



# Service Bulletin

File in Section: -

Bulletin No.: PI0917C

Date: February, 2014

## PRELIMINARY INFORMATION

**Subject:** Brake Squeal or Squeak Noise Intermittently on Initial Brake Applies

**Models:** 2013-2014 Buick Regal GS  
2013-2014 Cadillac ATS Equipped with RPO J55  
2013-2014 Cadillac XTS Equipped with RPO J64  
2014 Cadillac CTS Sedan Equipped with RPO J55 or J56  
2014 Chevrolet Corvette, SS

This PI has been revised to update the Parts Information. The lubricant can now be ordered from CCA. Please discard PI0917B.

### Condition/Concern

Some customers may comment on a squeal or squeak noise from the front brakes or rear brakes (Corvette only). This condition normally only occurs on initial brake applications after the vehicle has sat for an extended time. The condition occurs typically under light braking, in speeds under 16 km/h (10 mph). After 1-6 brake applies, or after braking at higher speeds, the noise no longer occurs. This condition may occur more often in high humidity conditions.

### Recommendation/Instructions

**Important:** Do not apply the lubricant to the back of the backing plate.

Apply a light coat of the lubricant to completely cover the pad backing plate abutments on each end. The lubricant should not extend onto the friction material. Refer to the illustration below.



3291081

### Parts Information

Part Number	Description	Qty
19303310	Lubricant	1*

Part Number	Description	Qty
(In Canada, use 19303311)		
*One tube will remedy approximately 5 vehicles.		

## Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2480038*	Apply Lubricant to Front or Rear Disc Brake Pads	0.6 hr
*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		