



Service Bulletin

File in Section: -

Bulletin No.: PI0965A

Date: March, 2014

PRELIMINARY INFORMATION


Subject: Squeaking/Creaking Type Noise Heard When Using Clutch Pedal

Models: 2012-2013 Chevrolet Cruze Equipped with Manual Transmission (RPOs MF3, MR5, MZ0)
2012-2013 Chevrolet Sonic Equipped with Manual Transmission (RPOs MZ4, M26)

This PI has been revised to add the Cruze to the Models section and update the Labor Operation to the Global Labor Code (GLC). Please discard PI0965.

Condition/Concern


Some customers may comment on a squeaking/creaking type noise heard when using the clutch pedal.

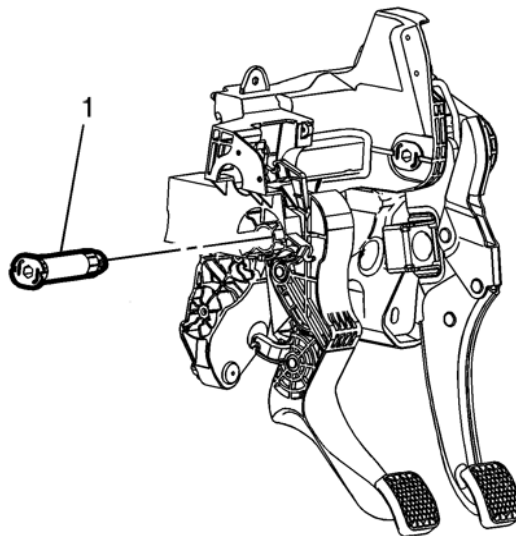

3412540

This may be caused from lack of or no lubrication on the clutch pedal pin (1) shown in the illustration above.

Recommendation/Instructions

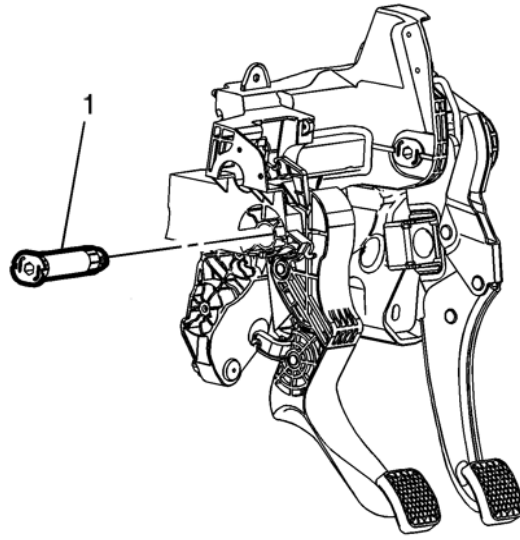

3412540

Apply GM Super Lube Part Number 12346241 (in Canada use 10953474) or equivalent around all the gaps on the clutch pedal pin (1) in the illustration above.

Note: **DO NOT** remove the clutch pedal pin during the lubrication process.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8480098*	Lubricating Clutch Pedal Pin	0.2 hr

*This is a unique Labor Operation for Bulletin use only. It will not be published in the Labor Time Guide.