



# Service Bulletin

File in Section: -

Bulletin No.: PI0970A

Date: March, 2014

## PRELIMINARY INFORMATION

**Subject:** Difficult to Engage Clamp(s) When Installing Soft Roll-up Tonneau Cover


**Models:** 2014 Chevrolet Silverado 1500  
2015 Chevrolet Silverado  
2014 GMC Sierra 1500  
2015 GMC Sierra  
Excluding 8 Foot - Long Box Vehicles

This PI has been revised to add the 2015 Model Year and a Note to the Condition/Concern.  
Please discard PI0970.

### Condition/Concern

**Note:** A production change was made to use a softer bulb seal on the tonneau clamps, which is grey in color. This PI only applies to the earlier used higher durometer bulb seal, which is black.


During installation of the soft tonneau cover, technicians/customers may find it difficult to engage the clamp(s).

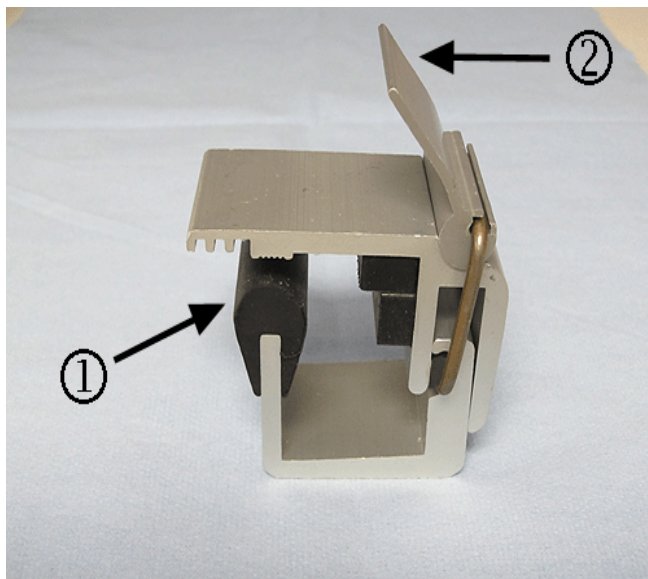

3436173


The cause of this condition may be the clamp bulb seal (1) not compressing enough to allow the bail (2) on the clamp to rotate to the lock position.

## Recommendation/Instructions

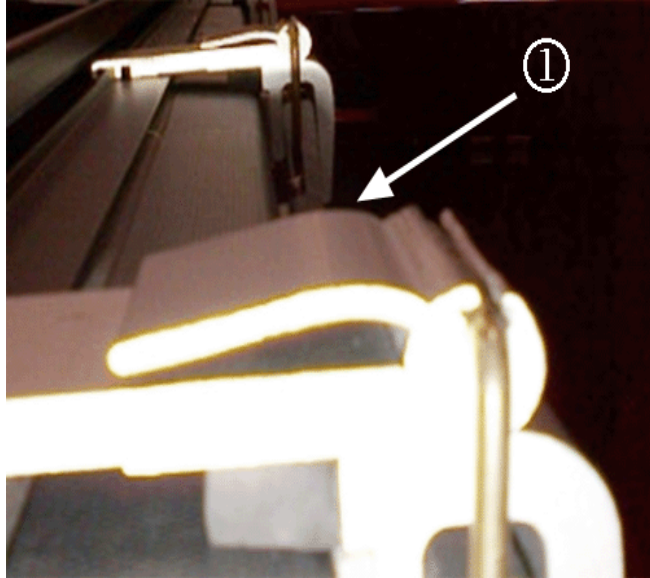


3436180

**Important:** Using excessive force to rotate the bail to lock position could damage the bail. If the bail of the clamp is bent (1) as shown in the graphic above, the clamp assembly will need to be replaced. The proper service part can be found in the Electronic Parts Catalog (EPC).

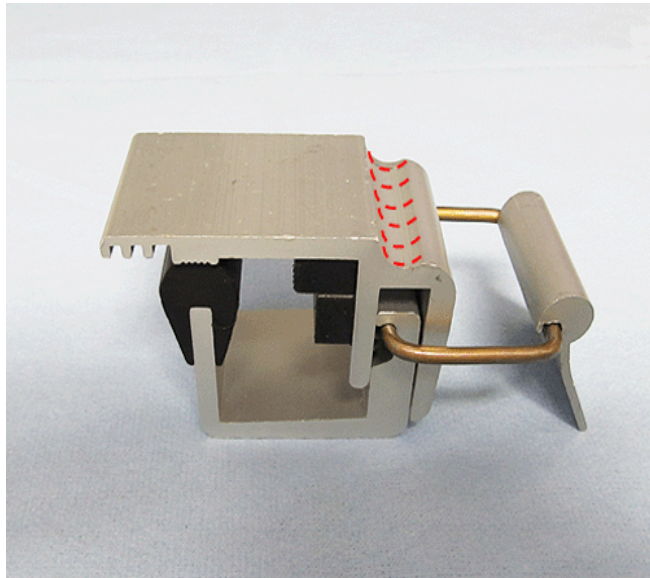

3436187

In most cases, the condition can be remedied by applying a thin coating of GM SuperLube with PTFE, P/N 12371287 (in Canada, P/N 10953437), or equivalent, to the pocket where the bail rotates on the clamp. Apply the lubricant to any affected clamp.

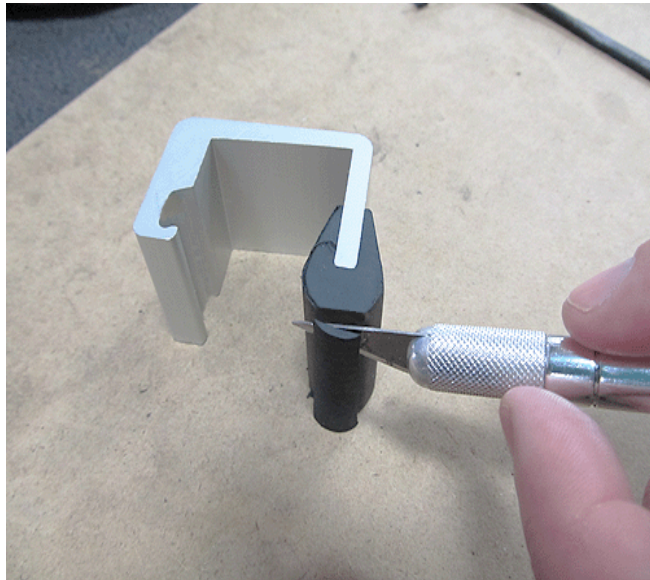

3436192

If it is still difficult to rotate the bail to the locked position, using a sharp knife, remove 2.0 mm (0.080 in) of material from the tip of the bulb seal on the clamp(s).