



Service Bulletin

File in Section: -

Bulletin No.: PI1172A

Date: September, 2014

PRELIMINARY INFORMATION

Subject: Bump on Launch, No Auxiliary Pump Pressure, DTC P2797 Set

Models: 2014-2015 Chevrolet Malibu
Equipped with 6T40 Automatic Transmission (RPO MNH)

This PI has been revised to add the 2015 Model Year. Please discard PI1172.


Condition/Concern

Some customers may comment that the vehicle has a hesitation, bump or jerking feel on launch. Technicians may find a DTC P2797 set in history or active code.

Recommendation/Instructions

This condition may be caused by low or no auxiliary fluid pump pressure. Follow SI diagnostics for DTC P2797.

- Be sure to verify transmission fluid level and condition.
- The auxiliary fluid pump can be controlled with a scan tool by navigating to Engine Control Module (ECM) Scan Tool Output Controls, Autostart/Autostop.
- Verify the line pressure is 145 kpa (21 psi) or greater when commanding the Autostart/Autostop ON with a scan tool with the engine shut off.

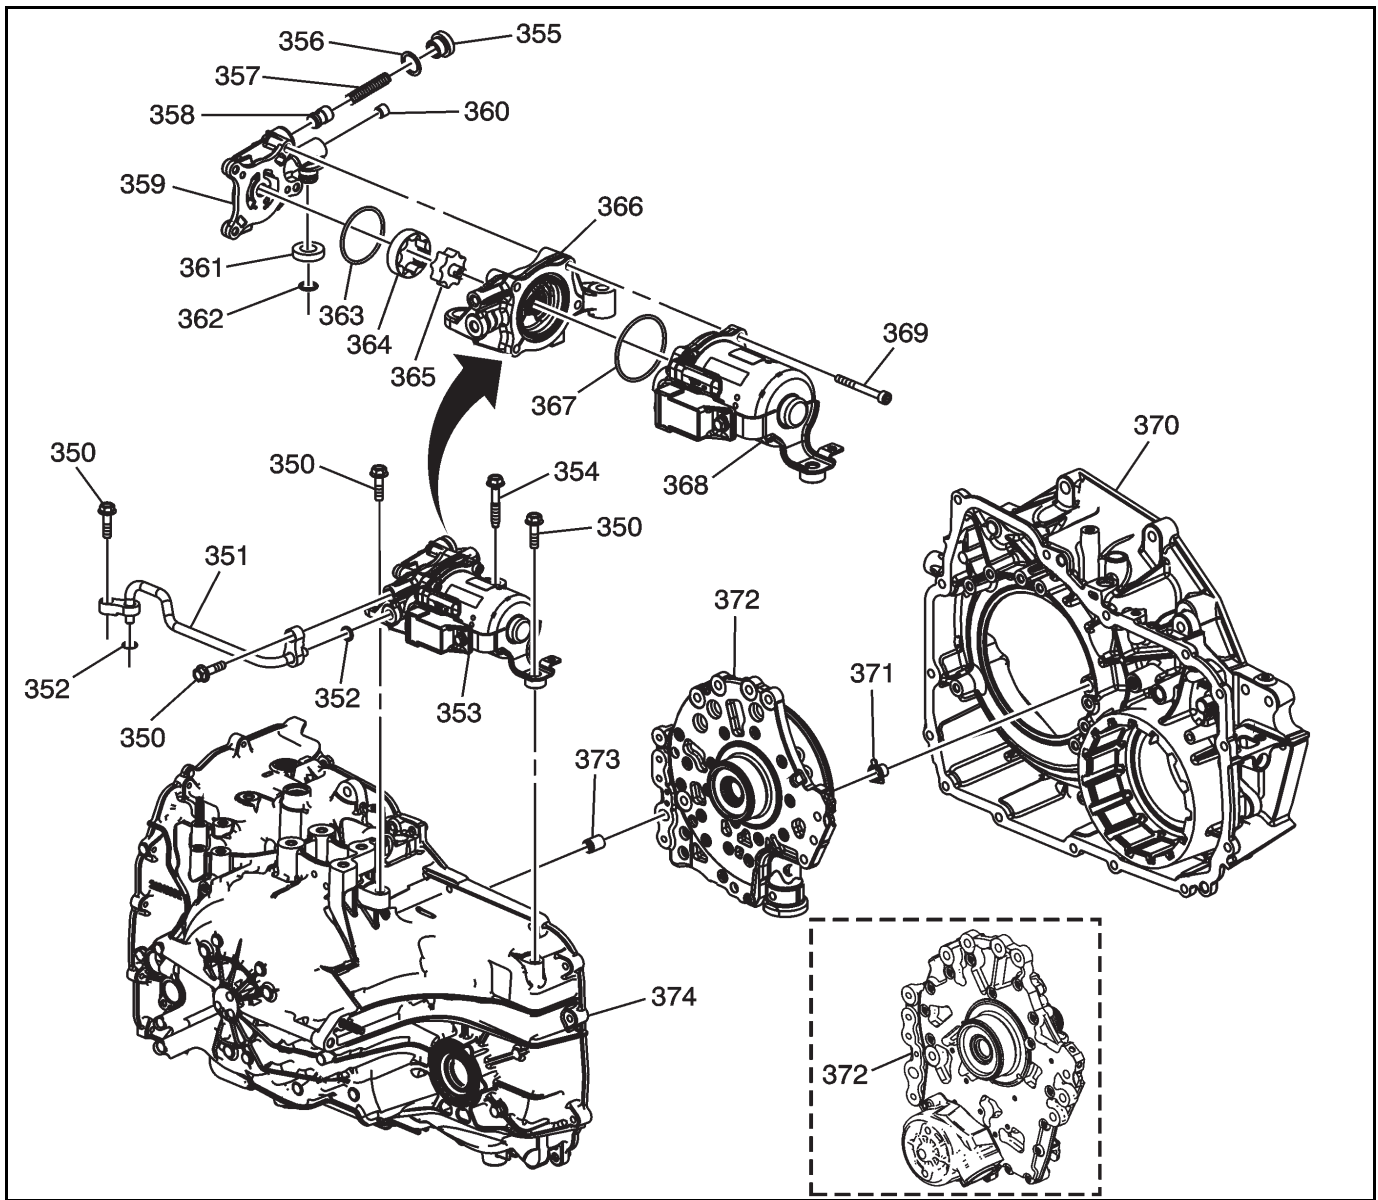

3271110

If the auxiliary pump runs but produces no line pressure, the condition may be caused by a damaged Auxiliary Fluid Inlet Pump Seal (item 371) shown in the illustration above. Inspect this seal for being damaged or torn.

Parts Information

Part Number	Description
24268339	SEAL KIT, A/TRANS FLUID PUMP (AUX PUMP INLET)

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8465050	Oil Pump Replacement	Use Published Labor Operation Time