

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Tiguan, Jetta	2009	All	All	All	All

Condition

97 14 01 April 8, 2014 2036976

Under Hood Fuse Panel (SA/SB assembly) with part number 000 937 125 Supplied Without Power Distribution Bar (SA panel)

Technical Background

The supplied under hood fuse panel (SA/SB assembly) with part number 000 937 125 comes without the power distribution bar (SA panel). When replacing an under hood fuse panel, the technician must remove the power distribution bar from the original under hood fuse panel and install it on the new assembly. See (Figure 1) below.

Production Solution


Not applicable.



Service

Modification of SA/SB assembly

Carefully remove the power distribution bar (Figure 1, number 1) with a suitable tool such as a small pocket screwdriver in the area of the three arrows (Figure 1).

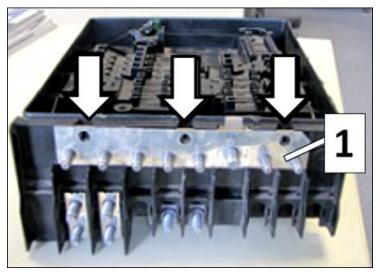

Install the power distribution bar to the new SB panel.

Note:

When using the new SB panel part number 000 937 125, the power distribution bar of the existing SB panel must be removed and installed on to the new SB panel. Make sure that the power distribution bar does not twist or bend.

Should the power distribution bar become compromised, please email vwoaspecialservices@vw.com

Figure 1

© 2014 Volkswagen Group of America, Inc.

Page 2 of 4



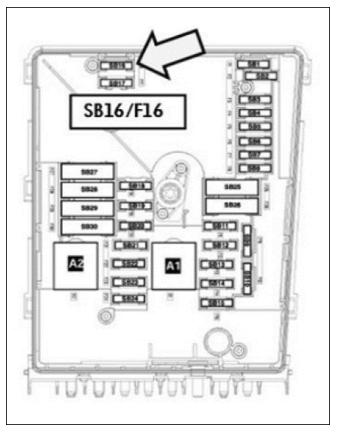


Figure 2

For the position SB 16 (figure 2) a 30 A fuse, part number N 017 131 25 must be used.

© 2014 Volkswagen Group of America, Inc.

Page 3 of 4



Warranty

Information only.

Required Parts and Tools

Part No:	Part Description	Quantity	
000 937 125	Fuse Panel	1	
N 017 131 25	Fuse (30 A, green)	1	
	Position SB 16		

No Special tools required.

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

© 2014 Volkswagen Group of America, Inc.

Page 4 of 4