



Service Bulletin

File in Section: -

Bulletin No.: PI1249

Date: June, 2014

PRELIMINARY INFORMATION

Subject: Buzz/Rattle Noise from Rear Speaker Area

Models: 2011-2014 Chevrolet Camaro Convertible
Equipped with Premium Audio System (RPO UQA)

Condition/Concern

Some customers may comment on a buzz or rattle type noise coming from the rear speaker area. This may be caused by the sub woofer wiring coming in contact with the sub woofer cone.

Recommendation/Instructions

Technicians should inspect and adjust the sub woofer wiring. Make sure the blue wire is resting on the metal frame and not on the cone paper.

1. Lower the convertible top.





3905439

2. Remove the left and right seat belt trim panels.




3905440

3. Remove the center trim panel.




3905442

4. Using a flat bladed tool, release the seat back retainers through the access holes located between the seat back cushion and the rear end trim finish upper panel.
5. Fold the seat back cushion down and line up the flats on the hinge pins with the slots on the hinges.
6. Pull the seat back cushion upward to remove it from the vehicle.

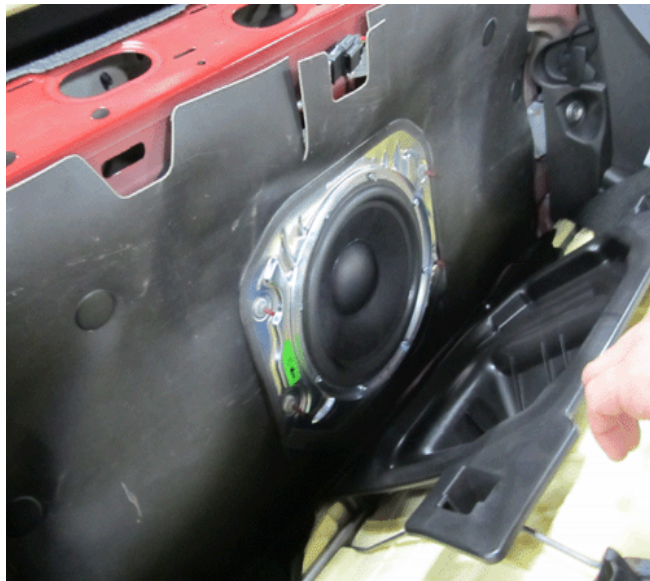


3905441

7. Remove the four nuts securing the sub woofer.

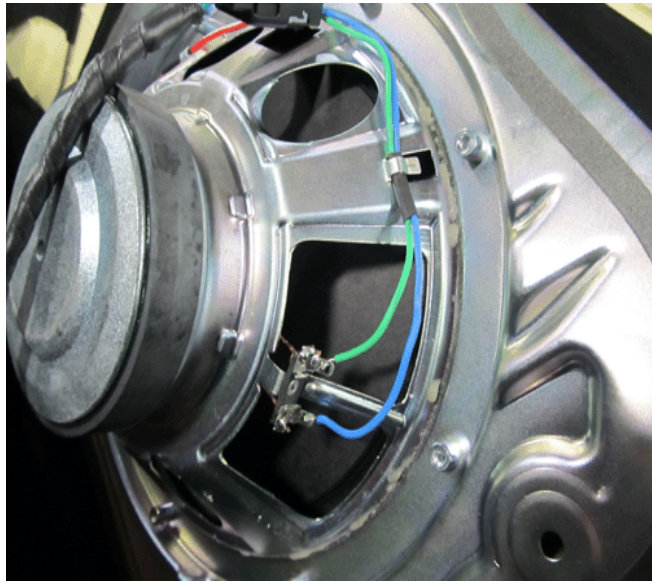


3905444

8. Remove the sub woofer from the opening.

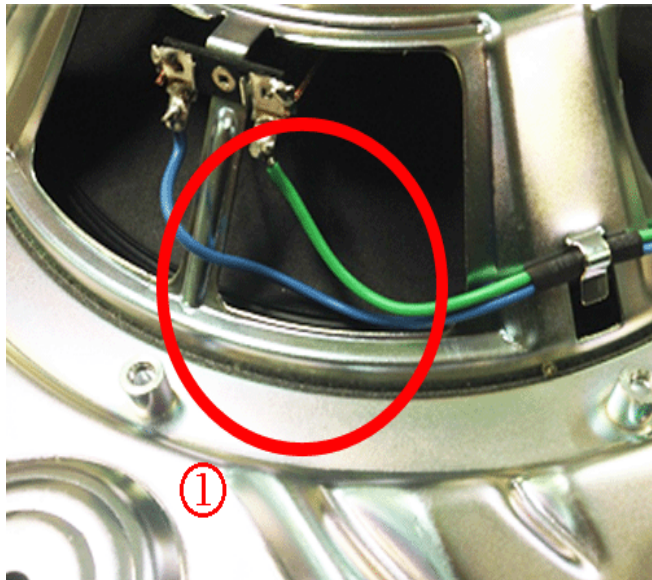

3905446

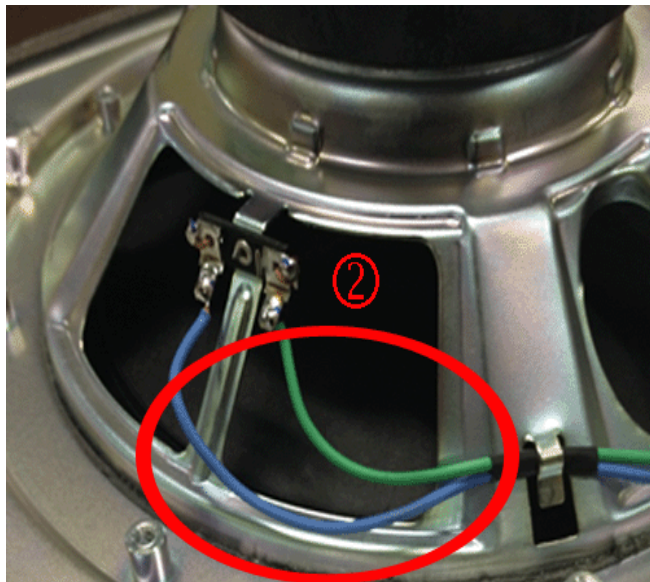

3905447

9. Inspect the sub woofer wiring and verify the wiring is not in contact with the sub woofer cone paper (1). Adjust the blue wiring if needed and ensure the wire is resting outside the metal frame (2).
10. Install the sub woofer and nuts to the vehicle.
11. Install the seat back cushion.
12. Install the center trim panel.
13. Install the left and right seat belt trim panels.
14. Lower the convertible top.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
3480088*	Inspect/Adjust Sub woofer Wiring	0.4 hr
*This is a unique Labor Operation for Bulletin use only. It will not be published in the Labor Time Guide.		