



# Service Bulletin

File in Section: -

Bulletin No.: P1255A

Date: July, 2014

## PRELIMINARY INFORMATION

**Subject:** Changing Outside Rearview Mirrors

**Models:** 2014 Chevrolet Silverado 1500  
2015 Chevrolet Silverado 2500  
2014 GMC Sierra 1500  
2015 GMC Sierra 2500  
Equipped with RPOs DL3, DL8, DE2, DPN, DF2

**Attention:** Any changes or modifications to the vehicle should be first reviewed with the customer, and then noted on the repair order with customer approval. This is for customer satisfaction; this is not a warranty procedure. This bulletin also applies to any of the above models that may also be export vehicles.

This PI has been revised to update the Models and Recommendation/Instructions.  
Please discard PI1255.

### Condition/Concern

Some customers may request to have a different style mirror installed on their vehicle or request a different mirror before they purchase the vehicle. The new electrical architecture for the Silverado and Sierra has made swapping mirrors a more involved procedure than with previous models.

### Recommendation/Instructions

#### DL3

– Mirrors, heated, power-adjustable, power-folding and driver-side auto-dimming, with integrated turn signal indicators and puddle lamps (includes driver's side spotter mirror)

#### DL8

– Mirrors, outside heated, power-adjustable, black (includes driver's side spotter mirror)

#### DE2

– Mirrors, Base Manual

### DL3 Mirrors

|  | DL3 | Upgrade to DPN |
|--|-----|----------------|
| Power Folding  | X   |                |
| Power-Adjustable (includes driver's side spotter mirror) | X   | X              |
| Puddle Lights  | X   |                |
| Integrated Turn Signal Indicators                        | X   | X              |
| Mono-Chromatic   | X   |                |
| Memory Function  | X   |                |
| Heated Mirror  | X   | X              |

## DL8 Mirrors

|   | DL8 | Upgrade to DPN |
|---|-----|----------------|
| Power Folding   |     |                |
| Power-Adjustable, Black (includes driver's side spotter mirror) | X   | X              |
| Puddle Lights   |     |                |
| Integrated Turn Signal Indicators                               |     | X              |
| Electro-Chromatic   |     |                |
| Memory Function   |     |                |
| Heated Mirror   | X   | X              |

## DE2

|   | DE2 | Upgrade to DF2 |
|---|-----|----------------|
| Power Folding   |     |                |
| Power-Adjustable, Black (includes driver's side spotter mirror) |     |                |
| Puddle Lights   |     |                |
| Integrated Turn Signal Indicators                               |     |                |
| Electro-Chromatic   |     |                |
| Memory Function   |     |                |
| Heated Mirror   |     |                |


When swapping to the trailer Tow Mirrors, the first thing to know is the installation of the trailer Tow mirrors may require the technician to add an additional mounting hole to the door (See chart below). Non-trailing mirrors only require 3 mounting holes. Trailer tow mirrors require 4 mounting holes.

Secondly, the Side Mirror Switch may need to be replaced for trucks built with RPO DL3. See chart below:

| Series              | RPO | RPO A45 | Drill 4th Mounting Hole | Replace Side Mirror Switch | Door Harness  |
|---------------------|-----|---------|-------------------------|----------------------------|---------------|
| <b>DL3</b>          |     |         |                         |                            |               |
| 1500                | DL3 | No      | Yes                     | Yes                        | No            |
| 1500                | DL3 | Yes     | Yes                     | No*                        | No            |
| 2500 (Plant Code Z) | DL3 | No      | Yes                     | Yes                        | No            |
| 2500 (Plant Code Z) | DL3 | Yes     | Yes                     | No*                        | No            |
| 2500 (Plant Code F) | DL3 | No      | No                      | Yes                        | No            |
| 2500 (Plant Code F) | DL3 | Yes     | No                      | No*                        | No            |
| <b>DL8</b>          |     |         |                         |                            |               |
| 1500                | DL8 | No      | Yes                     | Yes                        | As Required** |
| 1500                | DL8 | Yes     | Yes                     | No                         | As Required** |
| 2500 (Plant Code Z) | DL8 | No      | Yes                     | No                         | As Required** |
| 2500 (Plant Code Z) | DL8 | Yes     | Yes                     | No                         | As Required** |
| 2500 (Plant Code F) | DL8 | No      | No                      | No                         | As Required** |
| 2500 (Plant Code F) | DL8 | Yes     | No                      | No                         | As Required** |
| <b>DE2</b>          |     |         |                         |                            |               |
| 1500                | DE2 | No      | Yes                     | N/A                        | N/A           |
| 2500 (Plant Code Z) | DE2 | No      | Yes                     | N/A                        | N/A           |
| 2500 (Plant Code F) | DE2 | No      | No                      | N/A                        | N/A           |

\*The drivers switch should not be replaced and the power fold button will become non-functional.

\*\*Due to content differences, some vehicles may require the drivers and passengers door harnesses to be replaced. To determine if the door harness needs to be replaced, inspect connector X510 (Pins 5 and 13) and connector X610 (pins 5 and 13). If the cavities are empty, the door harnesses MUST be replaced.

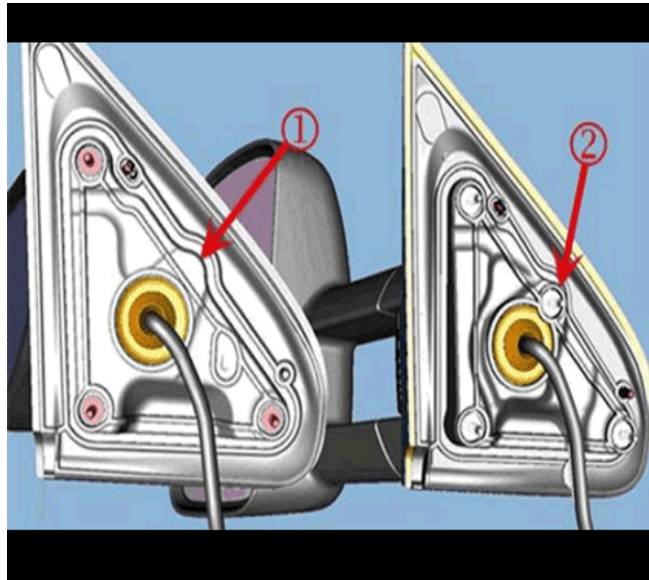

3802187

## Upgrade Instructions

1. Remove the front side door trim. Refer to Front Side Door Trim Replacement in SI.
2. Remove the front side door window garnish molding. Refer to Front Side Door Window Garnish Molding Replacement in SI.
3. Remove the outside rearview mirror nuts, disconnect electrical and remove the mirror.
4. If necessary, drill out the fourth hole (see chart above).
5. Install the new mirror, mirror nuts and connect the electrical.
6. Install new door harness (if necessary).
7. Install the new switch to the bezel.
8. Install the front side door window garnish molding. Refer to Front Side Door Window Garnish Molding Replacement in SI.
9. Install the front side door trim. Refer to Front Side Door Trim Replacement in SI.

**Note:** Trailer Tow Finish is Black only - see below for TT Finish P/Ns.

| Part Number | Description  | RPO   |
|-------------|--|---|
| 22820395    | MIRROR O/S LH, WIDE LOAD, FOLDING  | DF2   |
| 22820396    | MIRROR O/S RH, WIDE LOAD, FOLDING  | DF2   |
| 22820397    | MIRROR O/S LH, WIDE LOAD, FOLDING, VERTICAL GLASS, MAN EXTENDING, HEATED, TURN SIG IND | DPN   |
| 22820398    | MIRROR O/S RH, WIDE LOAD, FOLDING VERTICAL GLASS, MAN EXTENDING, HEATED, TURN SIG IND  | DPN   |
| 22754405    | SWITCH, O/S RR VIEW MIR R/CON  | CK157 (43-53)<br>(A31, DL8, DPN,<br>UQA, YE9, 4AA)<br>(EXC SLT) |

**Note:** Please do not contact Partech for a wiring harness, mirror or switch lookup as truck was not originally built with this configuration.

## Warranty Information

As the associated vehicle was modified outside of production specifications, labor associated with these procedures should NOT be charged under warranty. Rather, this should be customer pay.