



# Service Bulletin

File in Section: -

Bulletin No.: PIT5334A

Date: November, 2014

## PRELIMINARY INFORMATION

**Subject:** Dome Lamps Flash On And Off When Operating Brake Pedal Or Turn Signal

**Models:** 2015 Cadillac Escalade Models  
2015 Chevrolet Suburban, Tahoe  
2015 GMC Yukon Models

This PI was superseded to update Warranty Information and Labor Operation.  
Please discard PIT5334.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

Some owners may comment when the dome lamps are off, if the brake pedal is applied or turn signal is operated, the dome lamp will flash on and off. This issue may also occur when other electrical loads are operated, but the brake pedal and left turn signal are the most common. There will be no DTCs related to this issue.

**Note:** NOTE: This concern is a different issue than described in the latest version of PI1268. The issue in PI1268 is while the dome lamps are on and the brake pedal is applied or turn signals are flashing there is a change in the dome lamp intensity.

### Recommendation/Instructions

To correct this concern, replace both front overhead console lamps with GM Part Number 23104411.

### Parts Information

Part Number	Description	Qty
23104411	Front Courtesy Lamp	2

### Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
2080348*	Replace Both Front Overhead Courtesy Lamps	.4 Hrs
* This is an unique labor operation for bulletin use only. This will not be published in the Labor Time Guide.		

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.