



Service Bulletin

File in Section: -

Bulletin No.: PI1264A

Date: September, 2014

PRELIMINARY INFORMATION

Subject: Accessory Fog Lamp Kit Inoperative

Models: 2014-2015 Chevrolet Equinox
Equipped with RPO SSD

This PI has been revised to update Warranty Information. Please discard PI1264.


Condition/Concern

Technicians may notice that the accessory fog lamp kit (Part # 23206779) is inoperative after installation. This may be caused by a missing circuit in the IP harness.

Recommendation/Instructions


Technicians should add the missing circuit following the steps below.
Read all instructions before performing procedure.

1. If the Accessory Fog Lamp Kit is not functioning as intended, the probable cause is a missing circuit in the I/P Harness.
2. Check to see if circuit is missing in one of two ways:

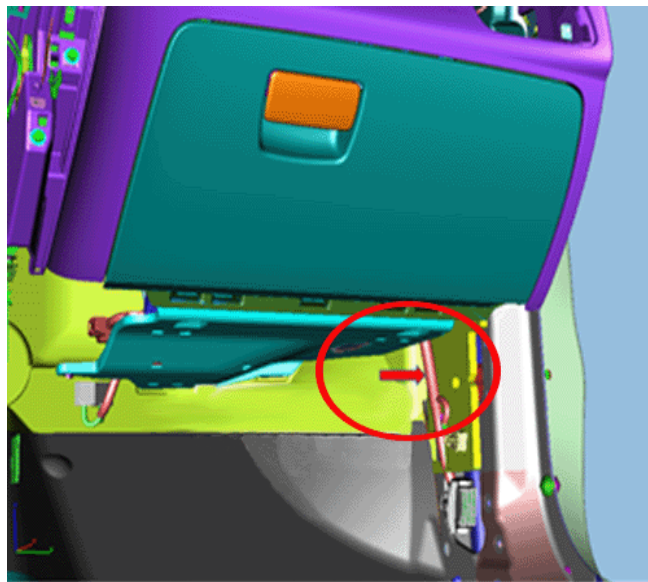


3942259

- 2.1. Visually inspect the I/P Harness part number tag on the Harness per below (I/P harness part number tag located between ground 207 and body inline connector):
 - 2014 MY Harness Part Numbers # 23164353; 23164354 and 23181681 requires an added circuit.
 - 2015 MY Harness Part Numbers # 23235768; 23235769 and 23235770 requires an added circuit.

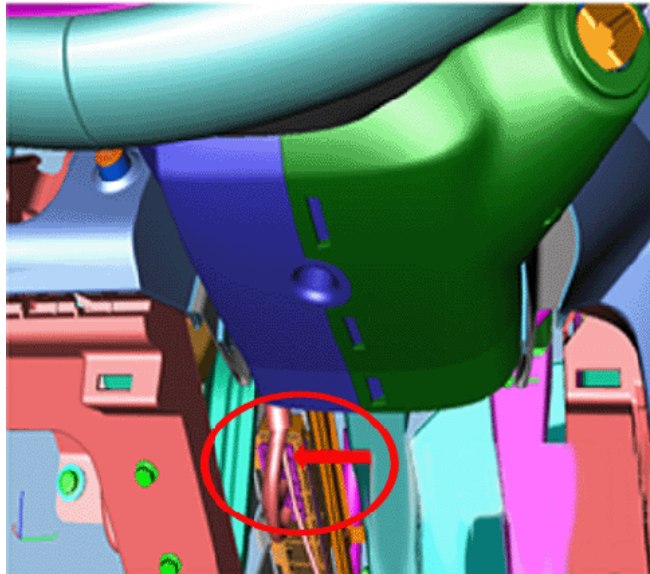

3942260

2.2. Visually inspect the I/P Harness BCM Connector 19151262 Cavity 14.

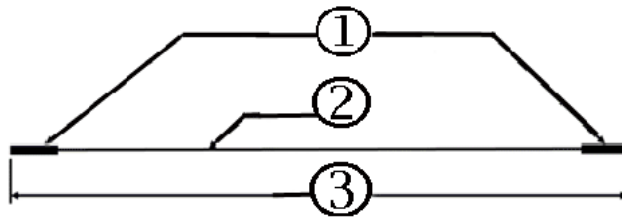


3942263

Legend


- (1) JST Terminal: SNAC3-A031T-M0.64. Crimp and solder terminal to wire
- (2) 0.80 (18 ga) TXL
- (3) 1000.0 mm (39.4 in)

-
3. If circuit 192 is missing, create the above circuit.
- Wire size can be from 0.35 to recommended 0.80.
 - Wire insulation type can be TWP or recommended TXL.

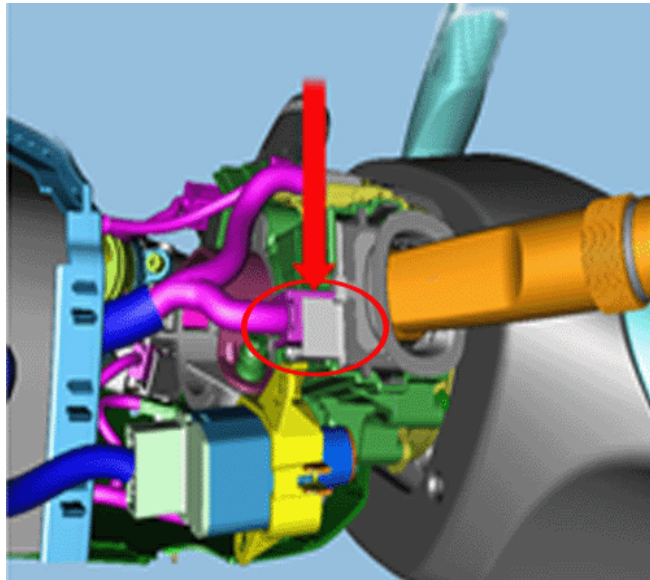

3942265

4. Install one end of the manufactured circuit into I/P Harness Multifunction Stalk SW Connector X1 (19167197) Cavity 1.

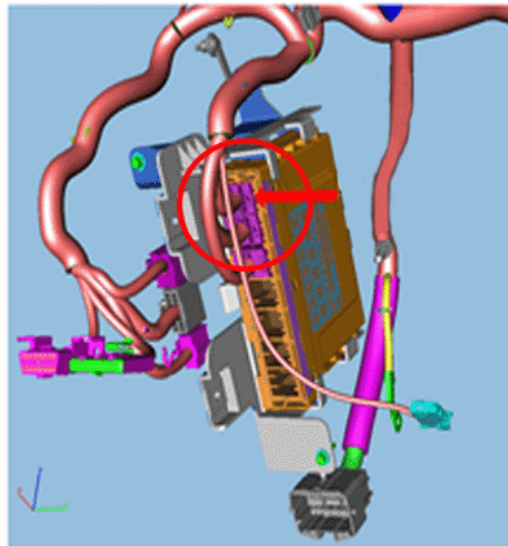

3942267

5. Install other end of the manufactured circuit into I/P Harness BCM Connector X1 (19151262) Cavity 14.
6. Attach the single wire with cloth tape to the main bundle.
7. Verify Accessory Fog Lamp function.

Parts Information

Part Number	Description
23206779	Accessory Fog Lamp Kit

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2680208*	Install Circuit to I/P Harness	0.5 hr
*This is a unique Labor Operation for Bulletin use only. It will not be published in the Labor Time Guide.		