



Service Bulletin

File in Section: -

Bulletin No.: PI1270

Date: June, 2014

PRELIMINARY INFORMATION

Subject: Rear Closure Center Applique Carrier Cracked

Models: 2014 Chevrolet Impala (VIN 1)
Vehicles Built Prior to June 1, 2013

Condition/Concern



3940146

Some customers may comment on cracks on the end of the rear applique carrier as shown in the illustration above.



3939373

This condition may be due to stress at the brass insert, as shown in the illustration above, which initiates cracking on the plastic.

Recommendation/Instructions

Replace the rear closure center applique carrier with one of the revised part numbers listed below. Refer to Rear Closure Center Applique Carrier in SI.

Parts Information

Part Number	Description
22749926	CARRIER, RR CLSR CTR APLQ (EXC RPOs AB5, UVC)
22749927	CARRIER, RR CLSR CTR APLQ (RPOs AQQ, UVC)
22749928	CARRIER, RR CLSR CTR APLQ (RPOs AB5, UVC)

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
1011330	Rear Closure Center Applique Carrier Replacement	Use Published Labor Operation Time