



# Service Bulletin

File in Section: -

Bulletin No.: P11272

Date: July, 2014

## PRELIMINARY INFORMATION

**Subject:** Drivers Side Object Detection Indicator Illuminated with No Objects Present on Drivers Side

**Models:** 2014 Chevrolet Malibu  
Equipped with RPO UFT  
Built Prior to June 2, 2014

### Condition/Concern

Some customers may comment that the side object detection indicator comes on with when there is nothing present on the drivers side.

This may be caused by the drivers side object detection module receiving reflected signals from objects on the passenger side of the car.

### Recommendation/Instructions

An updated software calibration has been released to address this condition. DO NOT replace any parts for this concern.

Update the side object sensor module using the Service Programming System (SPS) with the latest calibrations available on TIS2WEB. Refer to Side Object Sensor Programming and Setup in SI.

**Note:** On the SPS Supported Controllers screen, select B218L Side Object Sensor Module – Left – Programming and follow the on-screen instructions.

After programming has been completed, choose “Clear All DTCs” on the SPS screen.

### Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2810765	Side Object Sensor Reprogramming with SPS	Use Published Labor Operation Time