



# Service Bulletin

File in Section: -

Bulletin No.: P11282

Date: July, 2014


## PRELIMINARY INFORMATION

**Subject:** Shift to Park Message Displayed in Drivers Information Center (DIC) When Vehicle is Shut Off


**Models:** 2014 Chevrolet Corvette  
Equipped with Automatic Transmission (RPO MYC)

### Condition/Concern

Some customers may comment on a Shift to Park message displayed in the drivers information center (DIC) when the vehicle is turned off.

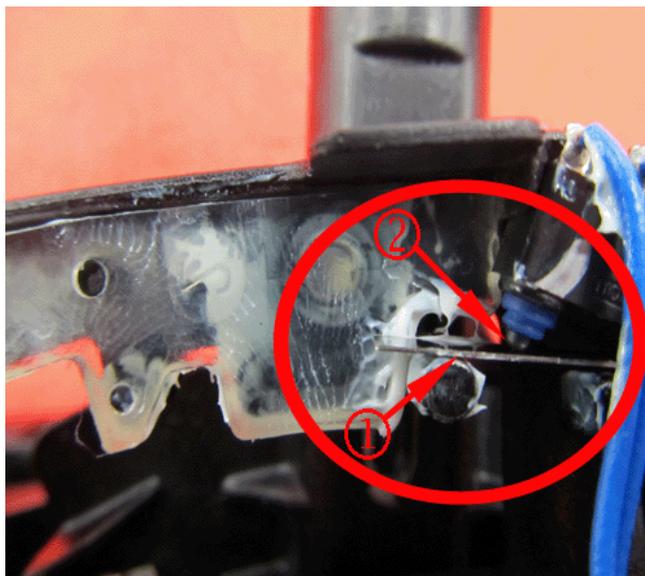

3945338

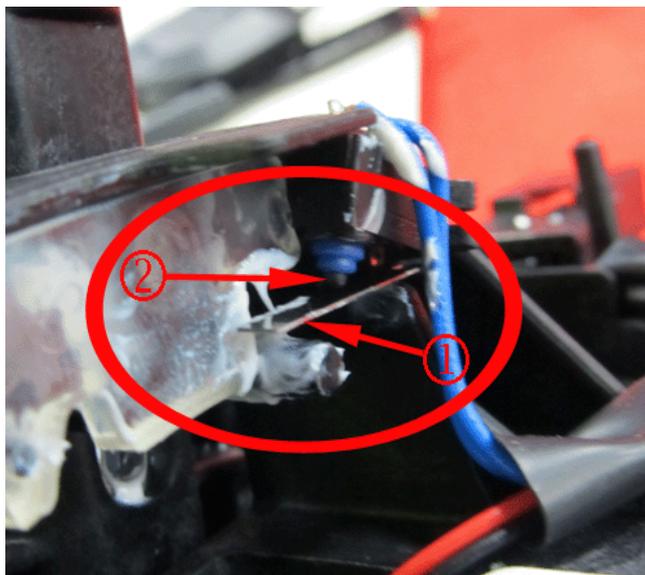

3945361


This condition may be caused by the shifter detent spring (1) being misadjusted, causing the shifter to not close the Park switch (2) as shown in the illustrations above.

## Recommendation/Instructions


Follow the procedure below for inspecting and/or adjusting the shifter spring detent and Park switch.

1. Remove the floor shift control boot assembly and inspect the location of the shifter spring detent. Refer to Floor Shift Control Boot Replacement in SI.

**Note:** If no adjustment is needed upon inspection with the detent spring while in Park, pursue with further diagnosis in SI. If the shifter spring detent is not closing the switch when the shifter is in the Park position, continue following the steps below.

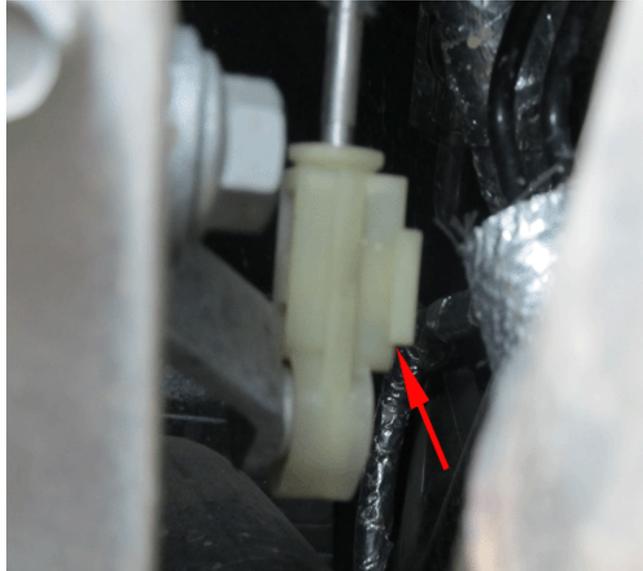

3944755

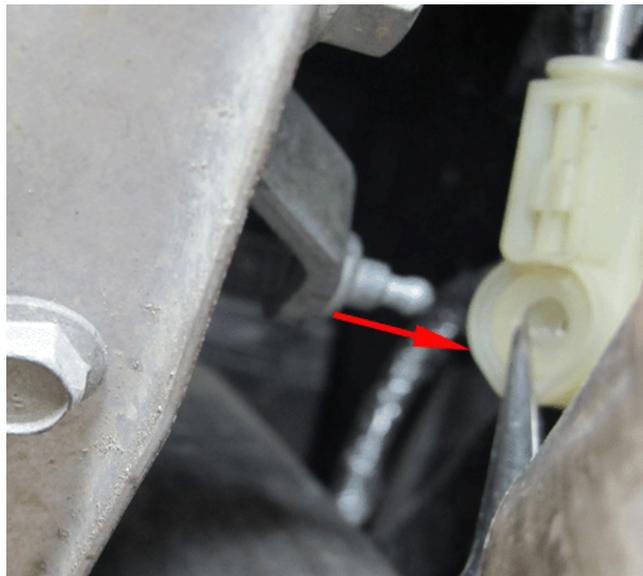


3945012

2. Raise the vehicle and disconnect the shifter cable as shown in the illustrations above. Refer to Lifting and Jacking the Vehicle in SI.
3. Lower the vehicle.



3944532

4. With the shifter in the Park position, loosen the screw retaining the shifter detent spring, as shown in the illustration above, and lightly move the shifter forward.

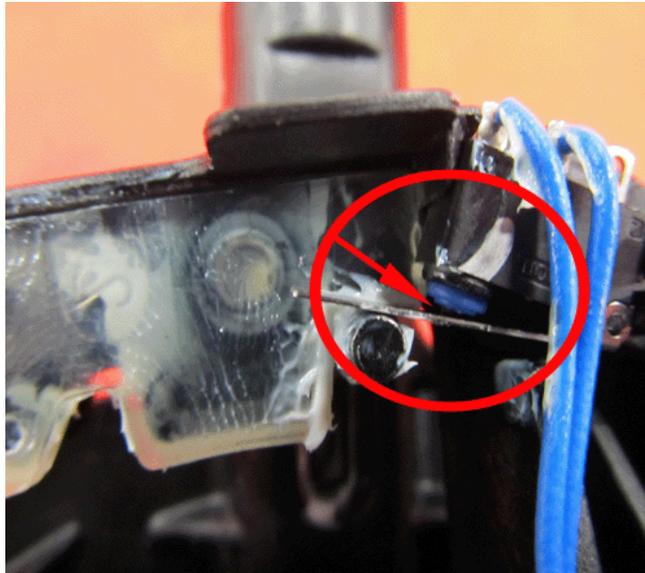

3944517

**Note:** Once the shifter is lightly moved forward, the detent spring will close the Park switch as shown in the illustration above.

5. Tighten the screw retaining the shifter detent spring.

**Tighten**

Tighten the screw to 3 N•m (26 lb in).

6. Cycle the plunger rod multiple times. Confirm the shifter operation and that the Shift to Park message is no longer displayed.

**Note:** Confirm **ALL** shifter operations and make sure that the Shift to Park message is no longer displayed in the drivers information center (DIC).

## Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
8480138*	Adjusting the Shifter Spring Detent	0.8 hr
*This is a unique Labor Operation for Bulletin use only. It will not be published in the Labor Time Guide.		