



# Service Bulletin

File in Section: -

Bulletin No.: PI1323

Date: October, 2014

## PRELIMINARY INFORMATION

**Subject:** 110 Volt Accessory Power Outlet Intermittently Inoperative

**Models:** 2015 Cadillac Escalade Models  
2014 Chevrolet Silverado 1500  
2015 Chevrolet Silverado, Suburban, Tahoe  
2014 GMC Sierra 1500  
2015 GMC Sierra, Yukon Models  
Equipped with Accessory 110 Volt Electrical Receptacle (RPO KI4)  
And Built Prior to Breakpoints Listed Below

Refer to the chart below for Plant/Build dates:

Plant	Built Prior To Date
Arlington	May 16, 2014
Silao	May 19, 2014
Fort Wayne	May 27, 2014
Flint	May 31 2014

### Condition/Concern

Refer to the chart before for Plant/Build dates:

Some customers may comment that the 110 volt power inverter accessory power outlet (APO) shuts off during accessory plug in and will not reset until unplugged.

Many components such as laptop computers have a larger than posted rating in-rush surge that occurs when the capacitors are significantly discharged.

### Recommendation/Instructions

The new Accessory AC and DC Power Control Module listed in Parts information has a "soft-start" function that will shut off momentarily during this condition but will continue to retry to power to a steady state as the accessory component capacitors load and the in-rush surge is overcome.

Technicians should replace the Accessory AC and DC Power Control Module. Refer to Accessory AC and DC Power Control Module Replacement in SI.

### Parts Information

Part Number	Description
13594713	MODULE, ACSRY AC

### Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
5420220	Accessory AC and DC Power Control Module Replacement	Use Published Labor Operation Time