



Service Bulletin

File in Section: -

Bulletin No.: PI1363

Date: December, 2014

PRELIMINARY INFORMATION

Subject: Information on Fuel Trim Reset After Oxygen Sensor Replacement

Models: 2014-2015 Chevrolet Cruze
Equipped with Diesel Engine (RPO LUZ)

Condition/Concern

Some technicians may find the malfunction indicator lamp (MIL) is illuminated after a recent oxygen sensor replacement.

This may be due to the fuel trim not being reset after the sensor was replaced.

Possible diagnostic trouble codes (DTCs) that a technician may find indicating that the fuel trim was not reset; P0133, P2297, P2A00, P0131-P0133, P11A6, P11A9, P2237, P2243, P2251, P0030-P0032, P0053, P0171 or P0172.

Recommendation/Instructions

If any of these codes above are present and the oxygen sensor has been recently replaced, perform the fuel trim reset using a scan tool.