



Service Bulletin

File in Section: -

Bulletin No.: PI1377

Date: December, 2014


PRELIMINARY INFORMATION

Subject: Rubbing Noise in Steering Column when Turning Steering Wheel

Models: 2014 Cadillac ELR

Condition/Concern

Some customers may comment on hearing a rubbing noise from the steering column while turning the steering wheel.

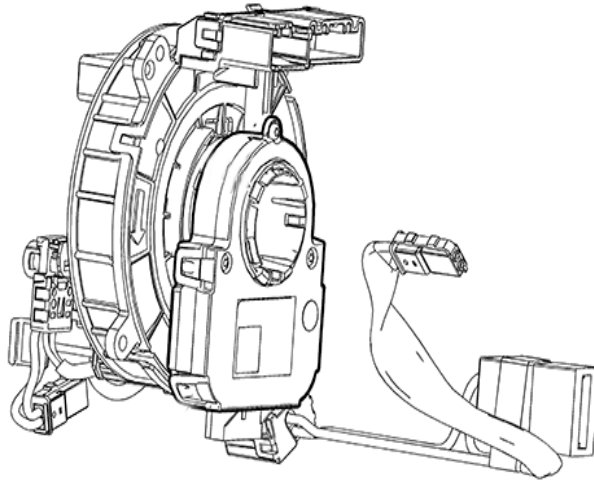


4035140

This may be caused by the steering angle sensor rubbing on the steering wheel airbag coil (SIR Coil).

Recommendation/Instructions

If this condition exists, follow the procedure below:

- Remove the steering wheel and check the part number on SIR coil. Refer to Steering Wheel Airbag Coil Replacement in SI.

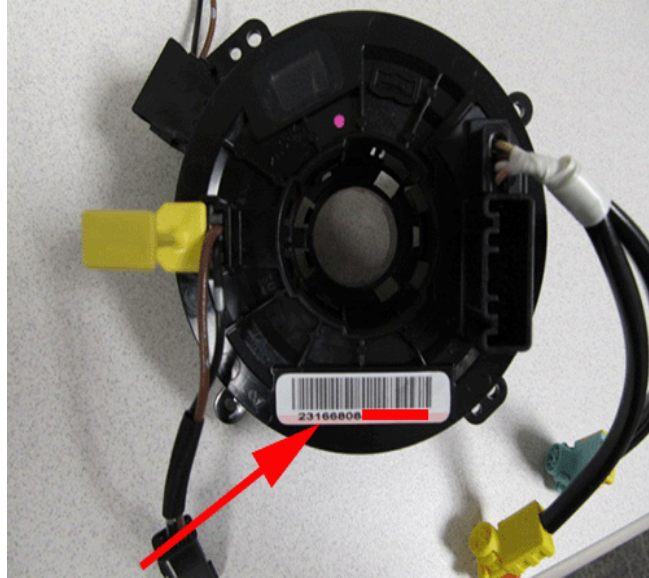

4035997

- If the first eight numbers are part number 23127905 on the SIR coil, replace the SIR coil with part number 23166808. Refer to Steering Wheel Airbag Coil Replacement in SI.
- If a newer SIR coil is already installed on the vehicle (part number 23166808), replace the steering angle sensor with part number 13589991. Refer to Steering Angle Sensor Replacement in SI.

Parts Information

Part Number	Description
23166808	COIL ASM-STRG WHL AIRBAG
13589991	SENSOR, STRG ANGLE

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
6450010	Steering Wheel Airbag Coil Replacement	Use Published Labor Operation Time
7440400	Steering Angle Sensor Replacement	Use Published Labor Operation Time