



Service Bulletin

File in Section: -

Bulletin No.: PI1383

Date: December, 2014

PRELIMINARY INFORMATION

Subject: Service Front Camera or Tire Learning Active Message on DIC at Start Up

Models: 2014 Chevrolet Impala (VIN 1)

Condition/Concern

Some customers may comment on a DIC message of "Service Front Camera" or "Tire Learning Active."

This message may go away after one or more key cycles.

The forward collision alert and the tire pressure monitoring systems continue to function as design intended.

Recommendation/Instructions

An updated software calibration has been released to address this condition.

Update the cluster using the Service Programming System (SPS) procedure in SI with the latest calibrations available on TIS2WEB.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2810195	Instrument Cluster Reprogramming with SPS	Use Published Labor Operation Time