

Reference	SSM71994
Models	Range Rover Evoque / L538
Title	9hp transmission. P0795, P07E3, P0893 faults
Category	Driveline
Last modified	07-Nov-2014 00:00:00
Symptom	504000 Other Automatic Transmission Concerns
Attachments	
Content	<p>Issue:</p> <p>A small volume of 14 & 15 MY Evoque (L538) are flagging the the following DTC codes - P0795-04 or P07E3-07 or P0893-07 which are related to the 9HP48 automatic transmission.</p> <p>Cause:</p> <p>Internal transmission diagnostics have been triggered - issues now resolved.</p> <p>Action:</p> <p>Update the Transmission Control Module (TCM) software to the latest available version. (versions at or above the software numbers listed below)</p> <p>Once updated, retest and if DTC does not occur again release to customer. If DTC captured again, please follow standard diagnosis procedures and refer to TOPIx instructions.</p> <p>(Further action post software update if applicable)</p> <p>Run the transmission adaption procedure which can be located by following symptom path below:</p> <p>Menu on SDD:</p> <p>Selected symptoms path:</p> <p>Powertrain, Auto transmission and trans – axle, Auto transmission and trans - axle symptoms, Harsh shift, Click continue, Recommendations.</p> <p>Software Level:</p> <p>EJ32-14C337-CBM.vbf..... DW12 AD</p> <p>EJ32-14C337-CDJ.vbf.....DW12 ED</p> <p>EJ32-14C337-CAM.vbf.....GTDi AD</p> <p>EJ32-14C337-CCJ.vbf.....GTDi ED</p>