-
KI

057 (Rev 3, 09/11/2014)	January 2014	
NUMBER	DATE	
ELE	Sorento (XMa)	
EI E	2014MV	
GROUP	MODEL	

TECHNICAL SERVICE BULLETIN

SUBJECT:

SERVICE ACTION: BCM UPGRADE - IPM LOGIC IMPROVEMENT (SA163A)

***** NOTICE

This bulletin has been revised to include additional information. New/revised sections of this bulletin are indicated by a black bar in the margin area.

This bulletin provides information related to a software upgrade for the Instrument Panel Module (IPM) of some 2014MY Sorento (XMa) vehicles, produced from January 22, 2013 through November 15, 2013 and equipped with a Power Tail Gate (PTG), which may exhibit an intermittent parasitic draw of up to 400mA. To prevent and/or correct this condition, the BCM should be reprogrammed using the GDS download, as described in this bulletin. Kia is requesting the completion of this Service Action on all affected vehicles. For confirmation that the latest reflash has been done to a vehicle you are working on, verify ROM ID using the tables in this TSB.



Global Diagnostic System (GDS)

***** NOTICE

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on WebDCS (Service> Warranty Coverage> Warranty Coverage Inquiry> Campaign Information). Not completed Recall / Service Action reports are available on WebDCS (Consumer Affairs> Not Completed Recall> Recall VIN> Select Report), which includes a list of affected vehicles.

This issue number is SA163A.

File Under: <ELECTRICAL>

Circulate To:	× G	eneral Manager	X Service Manager	X Parts Manager
Service Advisor	r(s)	X Technician(s)	🗵 Body Shop Manager	☐ Fleet Repair

Page 2 of 8 SUBJECT:

SERVICE ACTION: BCM UPGRADE - IPM LOGIC IMPROVEMENT (SA163A)

ECM Upgrade Procedure:

To correct this condition, the BCM should be reprogrammed using the GDS download as described in this bulletin.

UPGRADE EVENT NAME

225.XM FL IPM LOGIC IMPROVEMENT

* NOTICE

- A fully charged battery is necessary before the upgrade can take place. It is recommended that the Midtronics GR8-1299 system be used in ECM mode during charging. DO NOT connect any other battery charger to the vehicle during the upgrade.
- This upgrade must be performed with the ignition key in the OFF position.
- Make sure all vehicle doors are closed.
- Be careful not to disconnect any cables connected to the vehicle or GDS during the upgrade procedure.
- DO NOT start the engine during the upgrade.

ROM ID INFORMATION TABLES:

Upgrade Event #225

MODEL		ROM ID			
MODEL		PREVIOUS	NEW		
Sorento (XMa)	954001U220 954001U230 954001U240 954001U250	954001U2202010 954001U2302010 954001U2402010 954001U2502010	954001U2202110 954001U2302110 954001U2402110 954001U2502110		

To verify the vehicle is affected, be sure to check the Calibration Identification of the vehicle's BCM ROM ID and reference the Information Table as necessary.

- 1. Open the hood, disconnect the hood switch and connect the Midtronics charger to the battery.
- 2. Turn the ignition switch to the **OFF** position.
- 3. Connect the power supply cable to the GDS.

* NOTICE

If attempting to perform the upgrade with the power supply cable disconnected from the GDS, be sure to check that the GDS is fully charged before performing the upgrade. If the GDS is not fully charged, the upgrade may not occur. Therefore, it is strongly recommended that the power supply connector be connected to the GDS.

SERVICE ACTION: BCM UPGRADE - IPM LOGIC IMPROVEMENT (SA163A)

4. Connect the USB cable between the VCI and the GDS.



SUBJECT:

When performing the ECU upgrade using the GDS, wireless communication between the VCI and GDS is not available. Therefore, be sure to connect the USB cable between the VCI and the GDS.

- 5. Connect the Main 16-pin DLC cable (GHDM 241000) to the VCI.
- Connect the Main 16-pin DLC cable (GHDM – 241000) to the OBD-II connector, located under the driver's side of the instrument panel.
- 7. With the <u>ignition key OFF</u>, turn ON the VCI and GDS and manually input the VIN into the search box. Then, click the **Search** button.



CDS VN Search		and the second
5XYKWDA79EG436387 Sear	ch Auto VIN	Clear Previous Vehicle
Model	Year	Engine
AMANTI(GH) 2 BORREGO(HM) CADENZA(VG) FORTE(YD) FORTE/FORTE KOUP(TD) FORTE/FORTE KOUP(TD) 0 V900(KH) - OPTIMA HYBRID(TF HEV) 0 OPTIMA(MG) 0 OPTIMA(MG) 0 OPTIMA(TF/QF) RIO(BC) RIO(JB) -		
System	the second to be	Construction and a state of the second second
Group	and and some set	Symptom
Fault Code Searching	ок	Cancel

 At the GDS System Screen, select BCM. Then, select Body Control Module from the pop-up window and click OK.



TSB: ELE 057 / SA163A (REV 3) Sorento (XMa) January 2014

Page 4 of 8

SUBJECT: SERVICE ACTION: BCM UPGRADE - IPM LOGIC IMPROVEMENT (SA163A)

9. Select **ECU Upgrade** from the GDS main screen.



10. Select BCM and Click OK.



11. Select Auto Mode and click OK.



SUBJECT:

SERVICE ACTION: BCM UPGRADE - IPM LOGIC IMPROVEMENT (SA163A)

 After the system reads the ROM ID, select Event: 225. XM FL IPM Logic Improvement and Click Upgrade.



 Click OK on the voltage check screen and cycle the ignition ON and OFF once. Then, open the driver's door and click OK.



14. The upgrade will begin and the progress of the upgrade will appear on the bar graph.

***** NOTICE

If the upgrade fails, disconnect the negative (-) terminal from the battery for 20 seconds and restart the procedure.



Page 6 of 8

SUBJECT:

SERVICE ACTION: BCM UPGRADE - IPM LOGIC IMPROVEMENT (SA163A)

15. Click **OK** on the final screen. Upgrade event 225 is now complete.



- 16. Reconnect the hood switch.
- 17. Operate the tailgate to confirm proper operation.

Manual Mode Upgrade

***** NOTICE

Do NOT attempt to perform a Manual Mode upgrade unless Auto Mode fails. Always follow the instructions given on the GDS in either Auto or Manual mode. See the table below for Manual Mode passwords. SUBJECT:

SERVICE ACTION: BCM UPGRADE - IPM LOGIC IMPROVEMENT (SA163A)

MANUAL MODE ECM UPGRADE PASSWORDS:

Upgrade Event #225 Sorento (XMa)

MENU	PASSWORD
XM FL IPM : 95400-1U220	1220
XM FL IPM : 95400-1U230	1230
XM FL IPM : 95400-1U240	1240
XM FL IPM : 95400-1U250	1250

* NOTICE

Before performing the manual update, cycle the fuse box panel power switch to the OFF position for 20 seconds. Then, cycle the fuse box panel power switch back to the ON position.



- Within the ECU Upgrade screen, select Manual Mode in the left column, select BCM and then select Upgrade Event 225. Select the appropriate control unit part number by referring to the ROM ID Information Table on Page 2, and click OK.
- 2. Enter the appropriate password from the table above, and click **OK**.
- 3. Cycle the ignition ON and OFF once and open the driver's door, when prompted. Then, click **OK**.
- 4. Upgrade will begin and the progress of the upgrade will appear on the bar graph.
- 5. Click OK on the final screen. Upgrade event 225 is now complete.
- 6. Reconnect the hood switch
- 7. Operate the tailgate to confirm proper operation.

Page 8 of 8 SUBJECT:

SERVICE ACTION: BCM UPGRADE - IPM LOGIC IMPROVEMENT (SA163A)

AFFECTED VEHICLE PRODUCTION RANGE:

Model	Production Date Range			
Sorento (XMa)	From January 22, 2013 through November 15, 2013			

SERVICE ACTION WARRANTY INFORMATION:

Claim Type	Causal P/N	Qty	N Code	C Code	Repair Description	Labor Op Code	Time	Related Parts	Qty
V	95400 1U220	0	N99	C99	(SA163A) BCM(IPM) UPGRADE	140A15R1	0.3 M/H	N/A	0

***** NOTICE

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SA163A when accessing the WebDCS system.