TECHNICAL BULLETIN Q431 UPS8514-1bNAS1 17 NOV 2014



 $\ensuremath{\textcircled{C}}$ Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 310-02

Update Prior to Sale: Accelerator Pedal Defective Switch

AFFECTED VEHICLE RANGE:

| Range Rover Sport (LW) | | | | |
|------------------------|------|-----|--|--|
| Model Year: | 2015 | | | |
| VIN: | LW | -LW | | |
| Range Rover Sport (| LW) | | | |
| Model Year: | 2015 | | | |
| VIN: | LW | -LW | | |
| Range Rover (LG) | | | | |
| Model Year: | 2015 | | | |
| VIN: | LG | -LG | | |

MARKETS:

NAS

CONDITION SUMMARY:

Situation: A potential issue has been identified on a small number of 2015 model year Range Rover Sport (L494) and Range Rover (L405) vehicles where the accelerator pedal switch printed circuit board may not have been correctly soldered, leading to an intermittent connection. This may result in the vehicle entering restricted performance mode.

Action: Retailers are required to **HOLD** only affected vehicles that are within your control and refrain from releasing the vehicles for new or used vehicle sale pending completion of the rework action detailed in this Technical Bulletin. Unsold vehicles should have this performed as part of the Pre-Delivery Inspection (PDI) process but **must** have it completed prior to vehicle handover to the customer.

Affected vehicles already in the hands of customers should be updated at the next available opportunity.

PARTS:

No parts required

SPECIAL TOOLS:

Refer to Workshop Manual / Service Instruction for any required tools

WARRANTY:

NOTE: Check DDW to ensure that a vehicle is affected by this program prior to undertaking any rework action. Repair procedures are under constant review, and therefore times / prices are subject to

http://topix.landrover.jlrint.com/topix/service/procedure/508584/ODYSSEY_FSA/G18225... 12/2/2014

change; those quoted here must be taken as guidance only. Refer to TOPIx to obtain the latest repair time. At the time of confirming a booking for vehicle repair, ensure that all outstanding Service Actions are identified to ensure the correct parts are available and adequate workshop time is allocated for repairs to be completed at one visit.

Warranty claims must be submitted quoting Program Code **'Q431'** together with the relevant Option Code from the table. The SRO and part information listed have been included for information only. The Option Code(s) that allows for the drive in / drive out allowance may only be claimed if the vehicle is brought into the workshop for this action alone to be undertaken.

This program is valid for a limited time only. Warranty claims with a repair date prior to the **10 May 2015** closure date must be submitted for payment within 30 calendar days of completion of the repair.

| PROGRAM CODE | OPTION CODE | DESCRIPTION | SRO | TIME (HOURS) |
|-----------------|----------------|---|----------------------|--|
| Q431 | A | Check the accelerator pedal serial number, no further action | 19.20.01 | 0.20 - Range Rover Sport (L494) 0.10 - Range Rover (L405) |
| Q431 | К | Check the accelerator pedal serial number, no further action Drive in/drive out | 19.20.01 02.02.02 | 5 |

Normal Warranty policies and procedures apply

SERVICE INSTRUCTION:

TABLE 1: Accelerator Pedal Serial Number

| Accelerator Pedal Serial Number | | |
|---------------------------------|--|--|
| K1401-110920 | | |
| K1401-111406 | | |
| K1401-104323 | | |
| K1401-104951 | | |
| K1401-104458 | | |
| K1415-063532 | | |
| K1413-163400 | | |
| K1415-072354 | | |
| K1406-124632 | | |
| K1411-120218 | | |
| K1406-130753 | | |
| K1406-143638 | | |
| K1409-085533 | | |
| K1409-135217 | | |
| K1411-071326 | | |
| K1411-065908 | | |

1. ONOTE: if you are unable to view the serial number on the accelerator pedal, remove the accelerator pedal (see TOPIx Workshop Manual, section 310-02).

Check the accelerator pedal serial number.

- If the accelerator pedal serial number is not listed in the table above, reverse the removal procedure and release the vehicle.
- If the accelerator pedal serial number is in the table above, hold the vehicle for further parts ordering information.

