



Service Bulletin

File in Section: -

Bulletin No.: PIC5875A

Date: February, 2014

PRELIMINARY INFORMATION

Subject: Intermittent Hoot Whine Buzz Type Noise From The Brake Booster Area With Brakes Applied

Models: 2013 Buick Encore

This PI was superseded to communicate repair information. Please discard PIC5875.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

A customer may comment of an intermittent hoot, howl, whistle, whine, or buzz type noise when the brake pedal is applied while at a stop. Upon Dealer diagnostics the noise is perceived to be from the auxiliary vacuum brake assist pump or the brake booster area. The concern can be very intermittent and the dealer may have a difficult time duplicating the concern. The concern seems to happen in higher ambient temperatures and with a hot engine after an extended drive.

Recommendation/Instructions

If this noise is present, replace the Brake Booster Vacuum Hose with P/N 95412981 available from GM CCA. For repair information, reference the Power Brake Booster Vacuum Hose Replacement section of Service Information.

Parts Information

Part Number	Description	Qty
95412981	Brake Vacuum Hose with Check Valve	1

Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
2441660	Power Brake Booster Vacuum Check Valve and Hose Replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.