



# Service Bulletin

File in Section: -

Bulletin No.: PIC5994

Date: April, 2014

## PRELIMINARY INFORMATION

**Subject:** Heated Seat May Turn Itself Off

**Models:** 2014 Chevrolet Corvette  
Built Prior To April 5, 2014

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

The heated seat may turn off within a few minutes of being turned on. It can be turned on again, but may turn off again by itself. This condition could be intermittent - depending on the seat's position. DTC U1524 may also be set. This could be caused by a pinched wire in the seat assembly.

### Recommendation/Instructions

Inspect the seat cushion and seat back heater element harnesses for a pinch condition.

This pinch condition can occur near the rear inboard corner of the seat assembly and can be difficult to access without first removing the seat assembly from the vehicle.




3813385

If the harness is pinched, repair the wiring, reroute the harness and use a tie strap to hold the harness away from any pinch points – as reflected in the following photos.



3813386

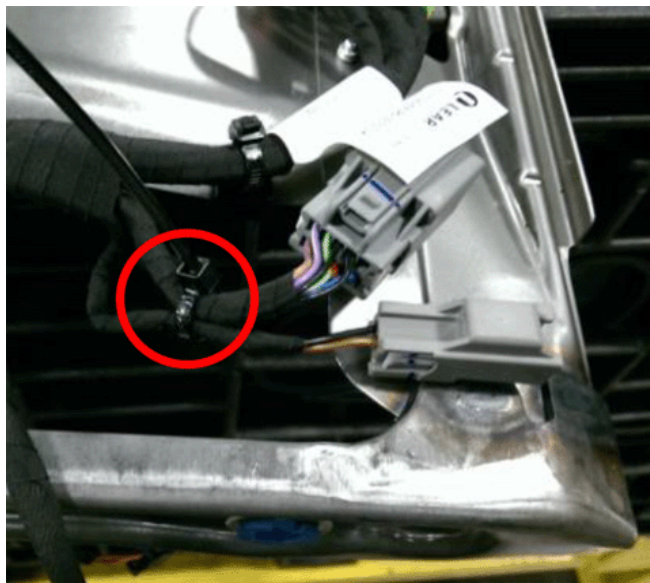

3813387

## Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.