



# Service Bulletin

File in Section: -

Bulletin No.: PIC6030

Date: October, 2014

## PRELIMINARY INFORMATION

**Subject:** Service Engine Soon Light On DTC P0442

**Models:** 2013 - 2015 Cadillac ATS Sedan  
Built prior to 8/9/2014

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.


### Condition/Concern

A customer may comment that they have a check engine light on

Upon further diagnostics, DTC P0442 - Evaporative Emission (EVAP) System Small Leak Detected may be set in the ECM.

### Recommendation/Instructions

Please check the fuel filler pocket rubber insulator to make sure it is not rolled over the fuel pipe neck as per the picture below.

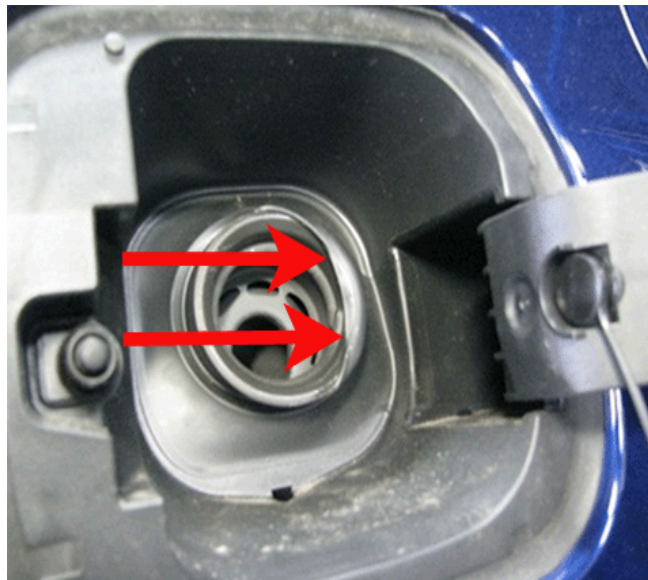

3979093

If the rubber is rolled over the filler neck, roll the rubber back over to the correct position. Check fuel filler cap to make sure the seal on the cap has not been damaged.

### Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
1480358*	Check And Reposition The Fuel Filler Pocket Rubber Insulator	0.2 hr

\* This is an unique labor operation for bulletin use only. This will not be published in the Labor Time Guide.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.