



Service Bulletin

File in Section: -

Bulletin No.: PIC6047A

Date: December, 2014

PRELIMINARY INFORMATION

Subject: Diagnostic Tip - Unable To Learn Tire Pressure Monitor After Service

Models: 2007 - 2012 Chevrolet Malibu

This PI was superseded to update Recommendation/Instructions. Please discard PIC6047.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

A technician may indicate that after performing a tire service (rotation), the vehicle will go into learn mode but not respond to a sensor or sensors that have been activated with the TPM tool.

Recommendation/Instructions

Please remove the B+ fuse for the Onstar VCIM. See the appropriate service information for the vehicle. If the technician is now able to complete the TPM learn proceed and then reinstall fuse.

Note: If an obvious fault or concern is present with Onstar and the account is active proceed with normal diagnostics.

Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
8080118*	Remove Fuse Then Re-learn The Tire Pressure Monitor System And Then Reinsert Fuse.	0.3 hr
* This is an unique labor operation for bulletin use only. This will not be published in the Labor Time Guide.		

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.