

- ATTENTION:**
- GENERAL MANAGER
  - PARTS MANAGER
  - CLAIMS PERSONNEL
  - SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.


© 2014 Subaru of America, Inc. All rights reserved.



QUALITY DRIVEN® SERVICE

**SERVICE INFORMATION**

**APPLICABILITY:** 2013-14MY BRZ

**NUMBER:** 07-86-14

**SUBJECT:** Vibration Sound from High-Mount Stop Lamp Assembly

**DATE:** 07/07/14

**INTRODUCTION**


This bulletin announces the availability of a new high-mount stop lamp assembly designed to address a customer concern of a vibration-type sound which may be heard while driving. Non-woven fabric material was added to eliminate the sound.

**COUNTERMEASURE IN PRODUCTION**

The new assembly was incorporated into production starting with VIN **E\*606202**.

**PART INFORMATION**

PART NAME:	NEW PART NUMBER
STOP LP AY HI MTG	84701CA002VH

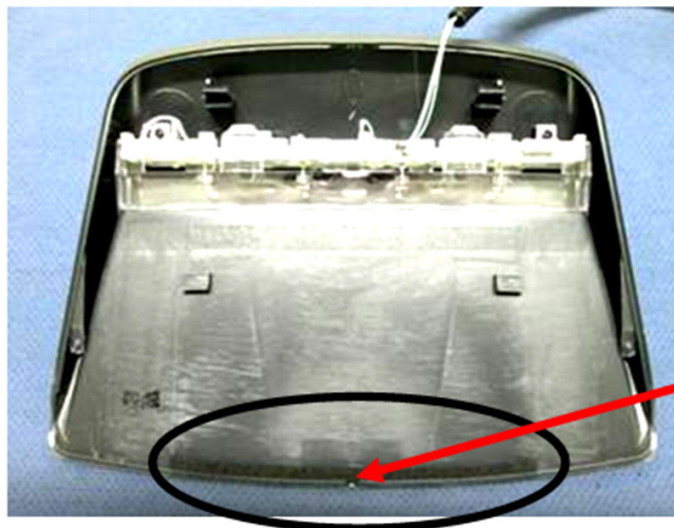


**Addition of non-woven fabric**

*Continued...*

<p><b>CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.</b></p> <p>Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.</p>	<p><b>SUBARU OF AMERICA, INC. IS ISO 14001 COMPLIANT</b></p> <p>ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.</p>
--	--


## SERVICE PROCEDURE / INFORMATION

1. Disconnect the wiring harness connector for the stop lamp which is located under the package shelf and accessible from the trunk area.

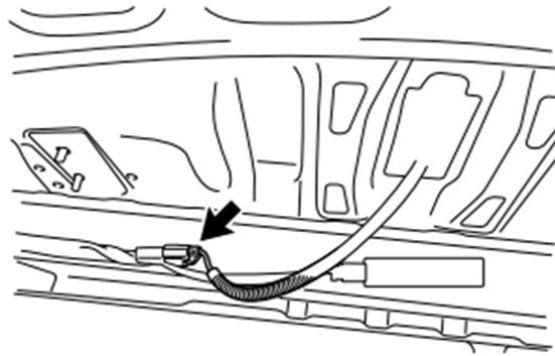



2. Using your thumbs on each side of the front edge, disengage the 2 retaining clips securing the upper section of the stop lamp assembly to the base portion. Once the front edge is separated and the clips released, slide the upper portion toward the front of the vehicle to disengage the 2 hooks from the base section.

**1 - Lift in the direction of the arrow to release the 2 retaining clips**

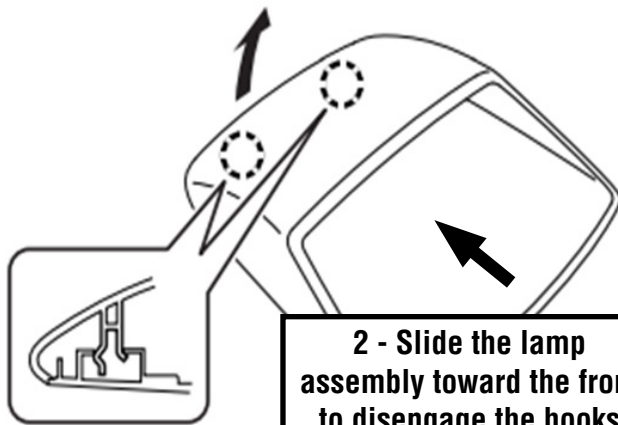


**2 - Slide the lamp assembly toward the front to disengage the hooks**

**Underside view of stop lamp**

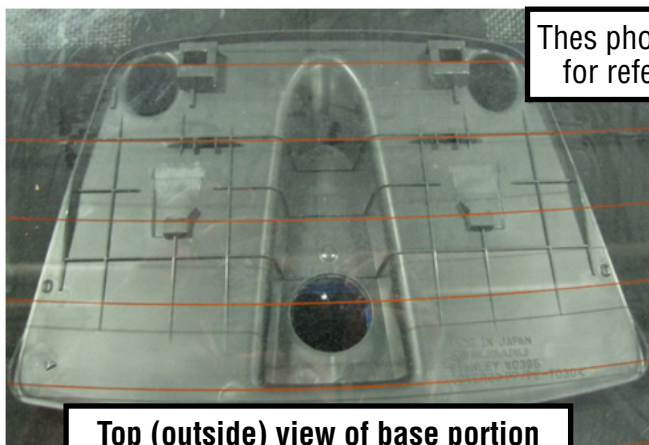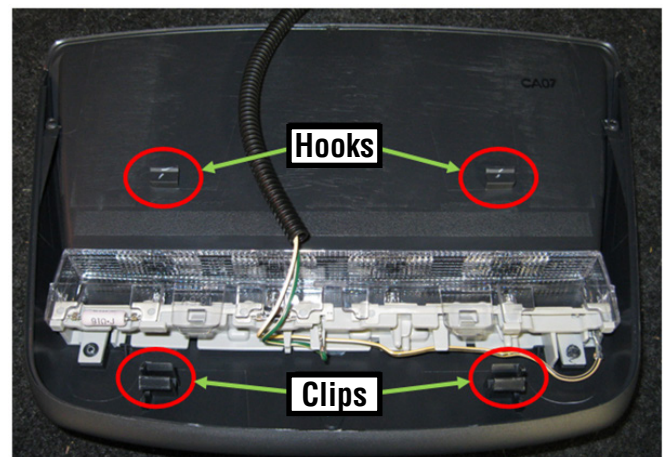

**Top (outside) view of base portion**

These photos provided for reference only

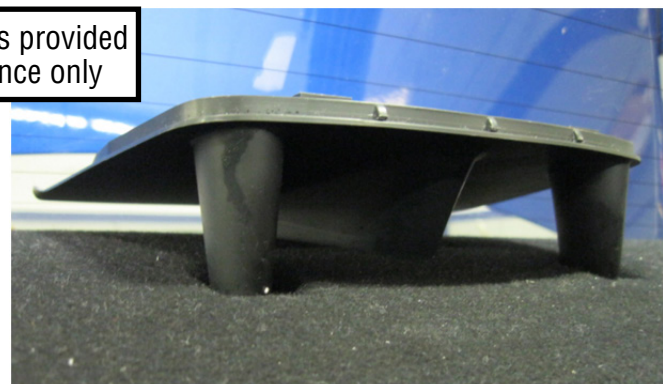

**Rear (inside) view of base portion**

3. Reassembly is the reverse order of removal.

*Continued...*

## WARRANTY / CLAIM INFORMATION

For vehicles within the Basic New Car Limited Warranty period, this repair may be claimed using the following information:

LABOR DESCRIPTION	LABOR OPERATION #	FAIL CODE	LABOR TIME
CENTER STOP LAMP ASSEMBLY R&R	A916-291	XGS-25	0.3

*Continued...*