

<b>Reference</b>	SSM72022
<b>Models</b>	XK / X150 F-TYPE / X152 XJ / X351 XF / X250
<b>Title</b>	Seat Module DTC diagnostic help - Seats not moving in one direction
<b>Category</b>	Electrical
<b>Last modified</b>	15-Oct-2014 00:00:00
<b>Symptom</b>	205000 Electrical Accessories
<b>Attachments</b>	

**Content**      Issue: **Seats not moving in one direction / one axis**  
Cause: **Motor connections not fully latched**  
Action:

**Indication of failure: - Seat inching in movement and DTC's logged in DSM & PSM**

**If customer states seat is not moving in one direction on one axis. Read DTC's with SDD. If any of the following DTC's are present;**

B1B87-31  
B1B89-31  
B1B91-31  
B1B93-31  
B1063-31  
B1064-31

**Follow the SDD DTC help recommendations to check the motor connections.**

**Carry this action out before replacing switch pack or seat module.**