

© 2014 Mazda Motor of America, Inc.

Subject: REAR MOUNT CAMERA DOES NOT OPERATE	Bulletin No: 09-016/14
	Last Issued: 02/25/2014

BULLETIN NOTE

- This bulletin supersedes the previous bulletin 09-016/13, issued on May 5, 2013. The APPLICABLE MODEL(S)/VINS, REPAIR PROCEDURE, PART(S) and WARRANTY INFORMATION have been revised.
- Changes are noted below in Red beside the change bar.

APPLICABLE MODEL(S)/VINS


2013-2014 CX-5 with VINs lower than JM3KE*****355501 (produced before May 28, 2013)

2014 Mazda6 with VINs lower than JM1GJ*****126340 (produced before June 5, 2013)

DESCRIPTION

Some vehicles may exhibit an inoperative rear mount camera. This concern may be caused by water entering inside the camera during a high-pressure car wash.

The shape of the camera has been changed to eliminate this concern.

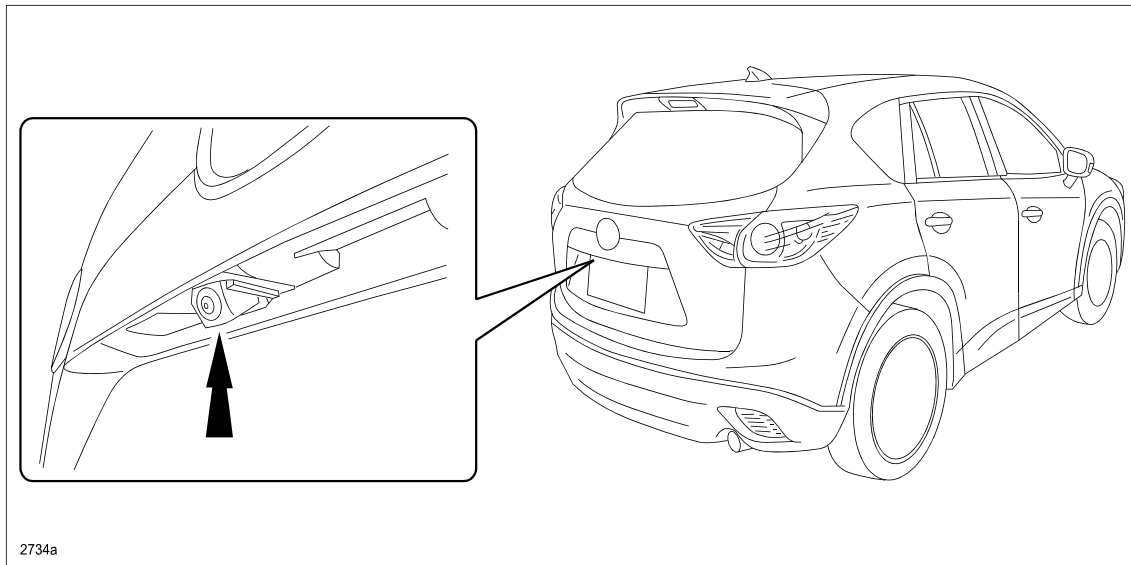


Customers having this concern should have their vehicle repaired using the following repair procedure.


REPAIR PROCEDURE

CX-5:

1. Verify the customer concern.
2. Disconnect the negative battery cable.
3. Remove the following parts according to the instructions on MS3 online or the Workshop Manual (section 09-20 REAR MOUNT CAMERA REMOVAL/INSTALLATION).
 - a. Liftgate upper trim.
 - b. Liftgate side trim (both sides).
 - c. Liftgate recess.
 - d. Liftgate lower trim.
4. Remove the license plate light (A) from the liftgate to improve accessibility.

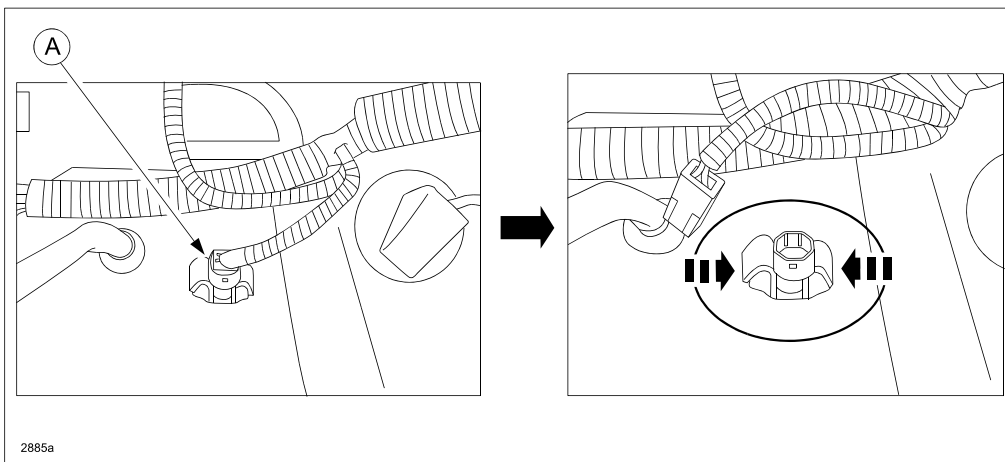

5. Remove the rear mount camera from the liftgate garnish.
 - a. Insert a tape-wrapped fastener remover into the area of the license plate light and detach the left tab of the rear mount camera.
 - b. Press the rear mount camera to left side using the tape-wrapped fastener remover.

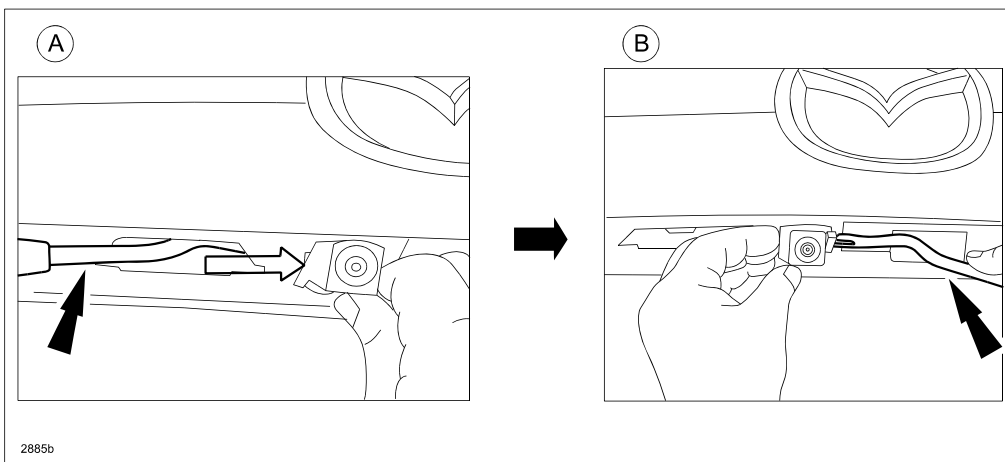

- c. Pull the rear mount camera from the liftgate garnish.

6. Install a modified rear mount camera into the liftgate garnish.
7. Install in the reverse order of removal.
8. Re-connect the negative battery cable.
9. Verify the repair.

MAZDA6:

1. Verify the customer concern.
2. Replace the rear mount camera according to the instructions on MS3 online or the Workshop Manual (section 09-20 REAR MOUNT CAMERA REMOVAL/INSTALLATION).
3. Verify the repair.

PART(S) INFORMATION

Part Number	Description	Qty.	Applicable Model
GJT1-67-RC0C	Rear mount camera	1	Mazda6
KD33-67-RC0C	Rear mount camera	1	CX-5

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

	CX-5	Mazda6
Warranty Type	A	A
Symptom Code	61	61
Damage Code	9K	9K
Part Number Main Cause	KD33-67-RC0C	GJT1-67-RC0C
Quantity	1	1
Operation Number / Labor Hours:	XXJCNXRX / 0.3 Hrs.	XXK3GBRX / 0.3 Hrs.