

© 2014 Mazda Motor of America, Inc.

Subject: HOOD VIBRATION ABOVE 68 MPH	Bulletin No: 09-015/14
	Last Issued: 02/25/2014

APPLICABLE MODEL(S)/VINS

2014 Mazda6 vehicles with VINs lower than JM1 GJ ***** 162912 (produced before December 03, 2013)

DESCRIPTION


Some vehicles may exhibit a hood vibration when driving above 68 mph (110Km/h). This may be caused by a cowl grill that is not firmly attached.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Replace the cowl grill seal (A). Refer to MS3 online or Workshop Manual (section 09-16 COWL GRILLE REMOVAL/INSTALLATION).

NOTE: The cowl grill seal is attached to the cowl grill with clips.

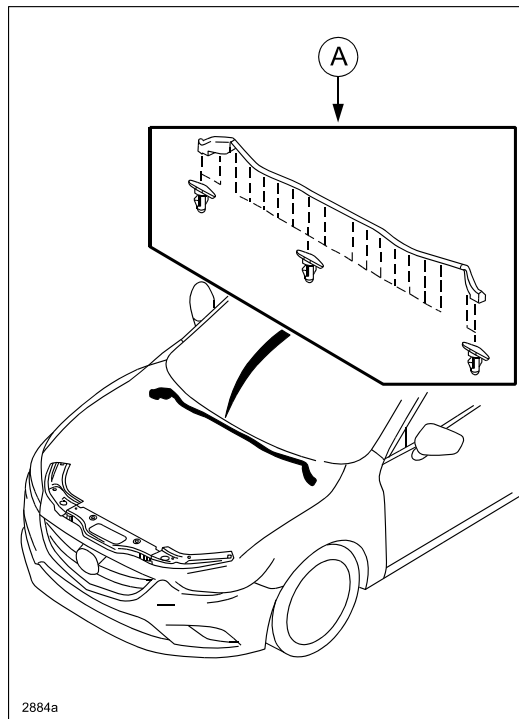

3. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.
GHP9-56-760A	Cowl Grill Seal	1

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	83
Damage Code	97
Part Number Main Cause	GHP9-56-760A
Quantity	1
Operation Number / Labor Hours:	XXK38XRX / 0.2 Hrs.