

Subject: MAZDA CONNECT FUNCTIONALITY CONCERNS AFTER MSP41	Bulletin No: 09-006/14
	Last Issued: 04/23/2014

BULLETIN NOTE

- This bulletin supersedes the previous bulletin 09-006/14, issued on 01/24/14, 03/25/14, 03/28/14. The APPLICABLE MODEL(S)/VINS, DESCRIPTION, REPAIR PROCEDURE, and WARRANTY INFORMATION have been revised.
- Changes are noted below in Red beside the change bar.

APPLICABLE MODEL(S)/VINS

2014 Mazda3 vehicles (with MAZDA CONNECT Infotainment System, audio, Bluetooth) with VINs lower than JM1BM*****205400 (produced before April 21, 2014)

DESCRIPTION

Some vehicles may experience the symptoms mentioned below, which can be fixed with the latest software update (Version 30.00.300 or later).

- Favorites (radio presets, navigation locations (including HOME)), Bluetooth pairing, sound adjustments, and route and warning settings are reset when CMU is reprogrammed.
- Favorites list displays only the channel numbers for XM radio stations.
- Cannot make a call successfully using Voice Recognition in French.
- Sound skips when playing music through Bluetooth connection.
- The navigation route guidance is not played after pairing iPhone 4s.
- Voice recognition fails after importing contacts with special characters (\$, #, etc) in the name (#MOM, \$AM).
- The music volume bar is displayed while the navigation is guiding a trip.
- The compass screen is displayed, even though a SD card is inserted.
- Sound is heard even though MUTE is selected.
- The navigation screen is rebooted.
- Navigation guidance is wrong due to loss of GPS signal.
- The navigation system does not recognize the current location.
- The radio screen is fuzzy and the commander switch does not operate.
- Selecting a contact address causes the touchscreen to flash white.
- A message "Invalid SD card" may appear on the center display while using the navigation system.
- A black screen may be displayed while using the navigation system.
- A blue screen may be displayed just after turning the ignition to ACC/ON.
- The center display does not boot up with a black screen.
- The center display may flicker while using WiFi connection.
- The navigation system sound volume cannot be changed.
- French pronunciation in voice guidance/wording of the navigation system is not correct.

NOTE: Mazda is working to make further improvements to the Mazda Connect Infotainment System software, and may issue future software updates to improve system operation and performance. Software version updates can be found on MS3 under IDS/Infotainment.

Customers having any of these concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Update MAZDA CONNECT with software version **30.00.300** or later using the instructions in TSB 09-034/13 - MAZDA SERVICE PROGRAM (MSP41) - MAZDA CONNECT INFOTAINMENT SYSTEM UPDATE
3. Verify repair.

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

SPECIAL CLAIM SUBMISSION INSTRUCTION:

- Perform an eMDCS Warranty Vehicle Inquiry on the VIN.
- View the status of MSP41
 - If MSP41 for the vehicle shows status of "Open" input the warranty claim using MSP41 OPEN information below. This will close the MSP41.
 - If MSP41 for the vehicle shows status of "Closed" input the warranty claim using MSP41 CLOSED information below.
 - If the vehicle is not flagged for MSP41, input the warranty claim using MSP41 CLOSED information below.

	MSP41 OPEN	MSP41 CLOSED
Warranty Type	A	A
Process Number	AD027B	--
Symptom Code	99	61
Damage Code	99	9W
Part Number Main Cause	7777-SP-J31	5555-RP-CMU
Quantity	0	0
Operation Number / Labor Hours:	XXK1HXFX / 0.3 Hrs.	XX30VXFX / 0.3 Hrs.

NOTE: For repairs performed after the date of this TSB, Operation No. **XX29VXFX** (for Version **29.00.000**) will no longer be accepted.