

Subject: MIL ON WITH DTC P0780 AND/OR P1738 OR OTHER DTCS	Bulletin No: 05-003/14
	Last Issued: 04/03/2014

BULLETIN NOTE

- This bulletin supersedes the previous bulletins 05-003/14 issued on 02/21/14 and 05-005/13 issued on 09/23/13, 9/25/13, 12/16/13, and 12/17/13. The PARTS INFORMATION has been revised.
- Changes are noted below in Red beside the change bar.

APPLICABLE MODEL(S)/VINS

2012-2013 Mazda3 vehicles (2.0L SKYACTIV-G A/T) with VINs lower than JM1BL*****733728 (produced before September 28, 2012)

DESCRIPTION

Some vehicles may experience the MIL ON with DTC P0780 (Gear shifting malfunction) and/or P1738 (Automatic transaxle internal malfunction) with/without U0401, or other DTCs stored in memory.

Other DTCs (with the above DTCs) - P0746:00, P0751:00, P0752:00, P0756:00, P0757:00, P0761:00, P0762:00, P0766:00, P0767:00, P0771:00, P0772:00, P079A:00, P0842:00, P0843:00, P0847:00, P0848:00, P0872:00, P0873:00, P0877:00, P0878:00, P1784:00

To correct the problem, a new programmed valve body has been established.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Replace the valve body assembly with a new one. Refer to MS3 online instructions or Workshop Manual section 05-17 CONTROL VALVE BODY REMOVAL/INSTALLATION [FW6A-EL].

NOTE: Replace the transmission oil pan bolts and hose clamp at the connector boot with new ones.

3. Perform the Initial Learning Procedure. Refer to MS3 online instructions or Workshop Manual section 05-17 INITIAL LEARNING [FW6A-EL].
4. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
PEY0-21-C00	Valve Body Assembly	1	PEY0-21-C00 does not need to be configured.
9YA0-10-615A	Oil Pan Bolts	16	Require replacement
FZ01-19-967	Hose Clamp	1	Requires replacement
FZ01-21-1P1	Gasket	4	Requires replacement
0000-FZ-113E-01	ATF-FZ	8	Available in 4 quart case

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Federal Emission Warranty long term (96 month / 80,000 miles). It will also be covered under CA PZEV Emission Warranty, where applicable.
- SKYACTIV valve body replacement for this concern no longer requires MASH authorization.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	14
Damage Code	9W
DTC Code	DTC P0780 and/or P1738 or other DTC
Part Number Main Cause	PEY0-21-C00
Quantity	1
Operation Number / Labor Hours:	XXJAVXRX / 2.4 Hrs.