

<b>Subject:</b> <b>EXCESSIVE CONDENSATION OR WATER WITHIN THE HEADLAMP ASSEMBLY</b> <b>- CAUTION</b>	<b>Bulletin No:</b> 09-049/14
	<b>Last Issued:</b> 11/24/2014

## BULLETIN NOTE

- This bulletin supersedes the previous bulletin 09-003/13 issued on 03/04/2013, 09-005/11 issued on 02/07/2011. The APPLICABLE MODEL(S)/VINS have been revised.
- Changes are noted below in Red beside the change bar.

## APPLICABLE MODEL(S)/VINS

2011- <b>2014</b> Mazda2	2007- <b>2016</b> Mazda6	2007-2012 CX-7	2006- <b>2015</b> MX-5
2007-2013 Mazda3	2008-2011 Tribute	2007- <b>2015</b> CX-9	
2006- <b>2015</b> Mazda5	2013- <b>2016</b> CX-5	2007-2011 RX-8	

## DESCRIPTION

When dealing with customer complaints of excessive condensation and/or water within the headlamp unit, first determine if all the bulb sockets are present and correctly installed. In most cases you will find that the Bulb Seal No. 1 (A) or HID Bulb Seal No. 1 (B) and Bulb Seal No. 2 (C) socket covers have not been correctly installed or are missing due to improper prior repairs (i.e., customer replacing the headlamp bulbs or body shop not transferring them when replacing the headlamp unit(s) due to a collision). Any damage caused by missing socket covers, HID module seal (D), or missing bumper brackets (E) is not covered by warranty policy.

