

© 2014 Mazda Motor of America, Inc.

Subject: REAR CONSOLE LID IS LOOSE	Bulletin No: 09-045/14
	Last Issued: 11/24/2014

BULLETIN NOTE

- This bulletin supersedes the previous bulletin 09-045/14, issued on 10/23/2014. The APPLICABLE MODEL(S)/VINS INFORMATION has been revised.
- Changes are noted below in Red beside the change bar.

APPLICABLE MODEL(S)/VINS

2014-2015 Mazda6 vehicles with VINs lower than JM1 GJ ***** 186473 (produced before May 14, 2014)

DESCRIPTION

Some customers may complain about a loose rear console lid (A).



This may be caused by hinge pins coming partially off (B) or completely off.

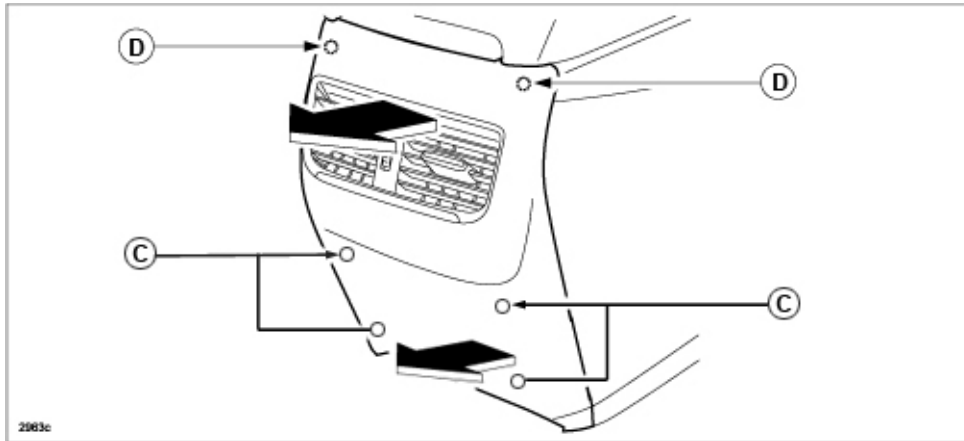


Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Remove the rear console panel by pulling in the direction of the arrows shown below.

NOTE: Begin by pulling from the bottom to detach inner attachment clips (C), then continue pulling from the top to detach inner attachment clips (D).



3. Re-install the rear console lid pin(s) back to the original position.

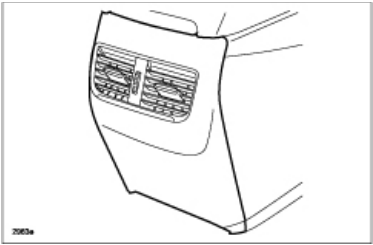
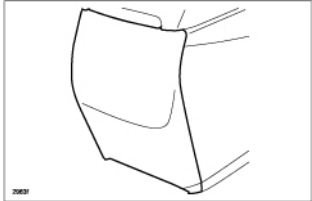


4. Install a new rear console panel. (See PART(S) INFORMATION)

NOTE: The shape of the rear console panel has been changed, by adding a stopper rib to prevent the pin from coming off.

5. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
GHR1-64-470A-02	Rear Console Panel	1	With Ventilation 
GHP9-64-470 -02	Rear Console Panel	1	Without Ventilation 

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	91
Damage Code	97
Part Number Main Cause	GHP9-64-470 02 or GHR1-64-470A 02
Quantity	1
Operation Number / Labor Hours:	XXK9XXRX / 0.2 Hrs.