

© 2014 Mazda Motor of America, Inc.

<b>Subject:</b> <b>CREAKING NOISE FROM FRONT LOWER CONTROL ARM BUSHINGS</b>	<b>Bulletin No:</b> 02-005/14
	<b>Last Issued:</b> 12/12/2014

## APPLICABLE MODEL(S)/VINS

2013-2015 Mazda3


2014-2015 Mazda6

2013-2015 CX-5

## DESCRIPTION

Some vehicles may exhibit a creaking noise from under the front of the vehicle when driving over bumps. The noise occurs at approx. 12 - 25 mph (20 - 40 Km/h) when the road surface is wet or after a car wash. The noise becomes more noticeable when driving over higher bumps.


The creaking noise is caused when the front lower control arm bushing(s) (A) become wet.

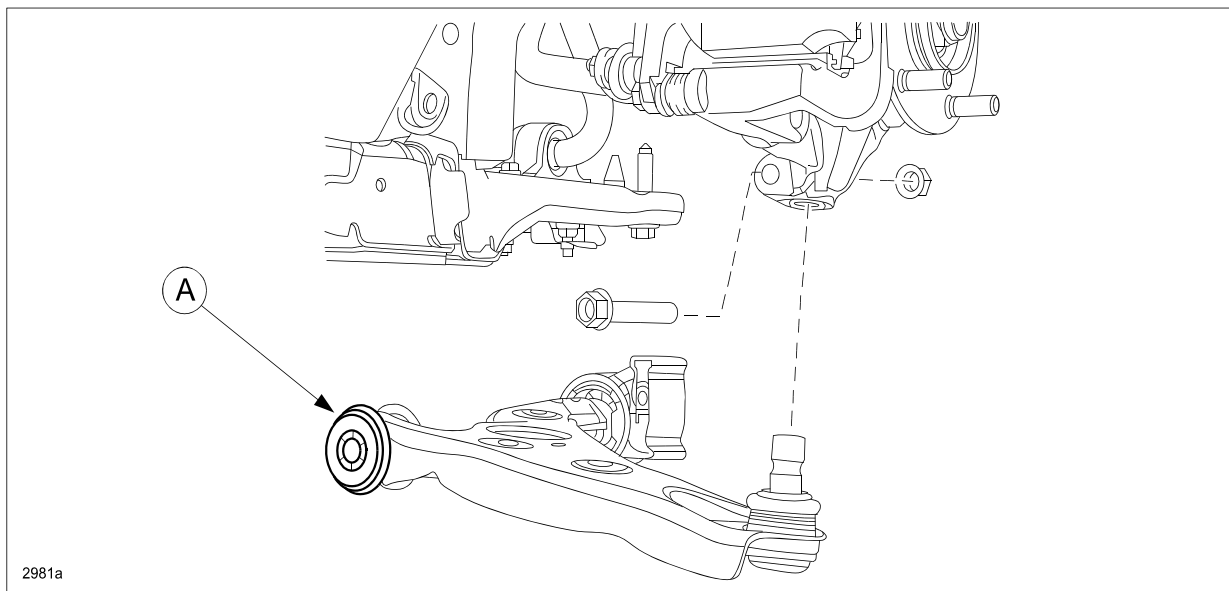

Customers having this concern should have their vehicle repaired using the following repair procedure.

## REPAIR PROCEDURE


1. If possible, verify the customer concern when driving over bumps under wet conditions.
2. Replace front lower control arm bushing with new service part according to Steps 3 - 8.
3. Remove the front lower control arm according to the on-line instructions on MS3 or the Workshop Manual (section 02-13 FRONT LOWER ARM REMOVAL/INSTALLATION).
4. Remove the front lower arm bushing using SSTs 49 G030 797 and 49 B025 004.
5. Place the SSTs on the front lower control arm as shown below, then press out the bushing.

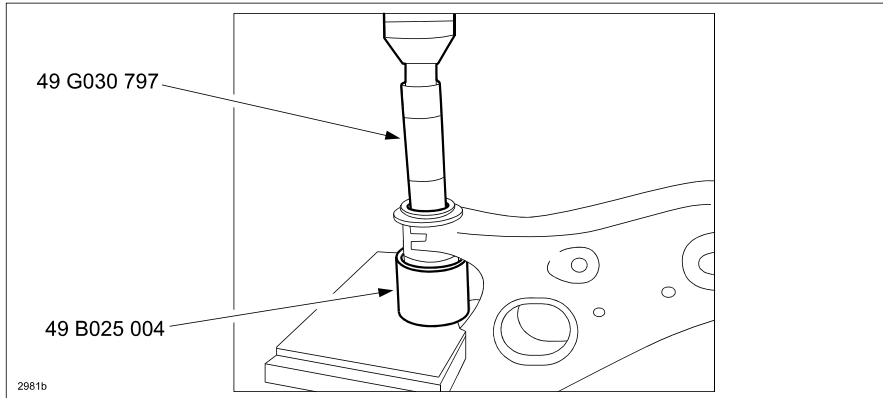


6. Install the modified bushing using the same SSTs.

### NOTE:

- Apply soap suds to the bushing to ease the installation.
- Always wipe off soap suds from the front lower control arm and bushing with a cloth.
- Install the bushing so the projection (A) is pointing toward the front of the vehicle.

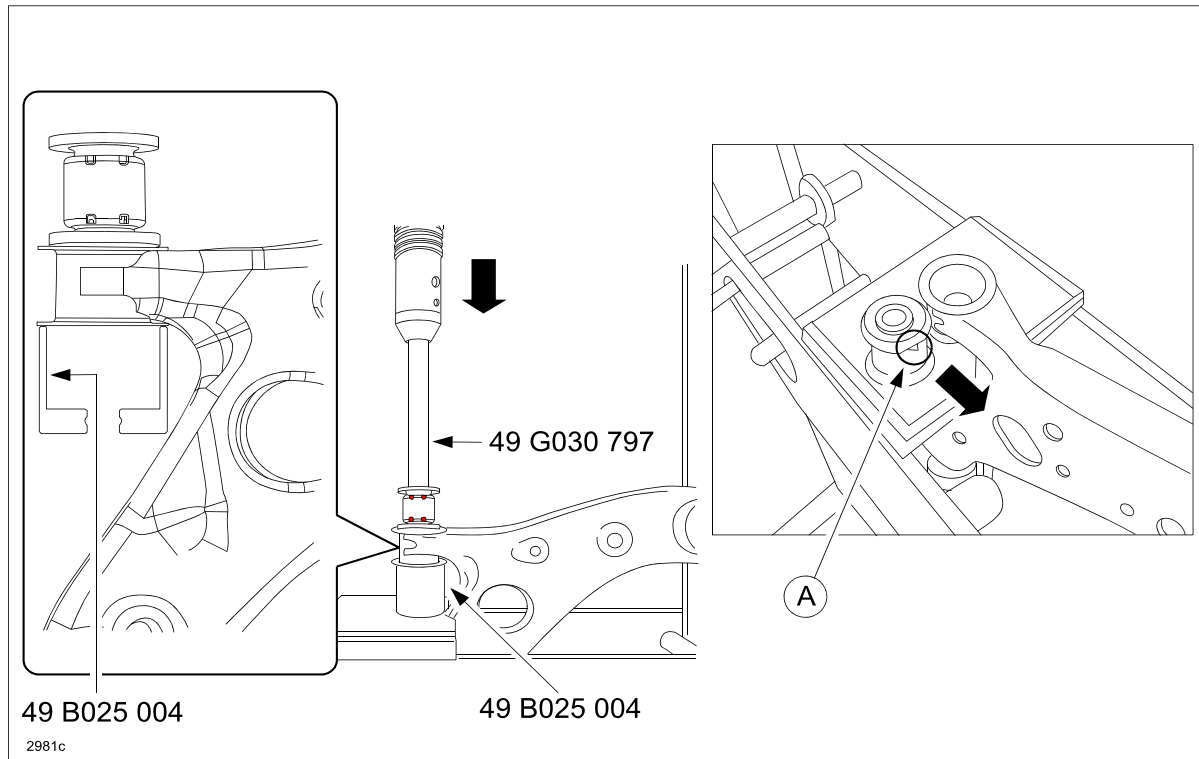

7. After installing the bushing, verify the distance between the front lower control arm (A) and front lower control arm bushing inner pipe (B) equals 5.8 +/- 0.8mm as shown below.

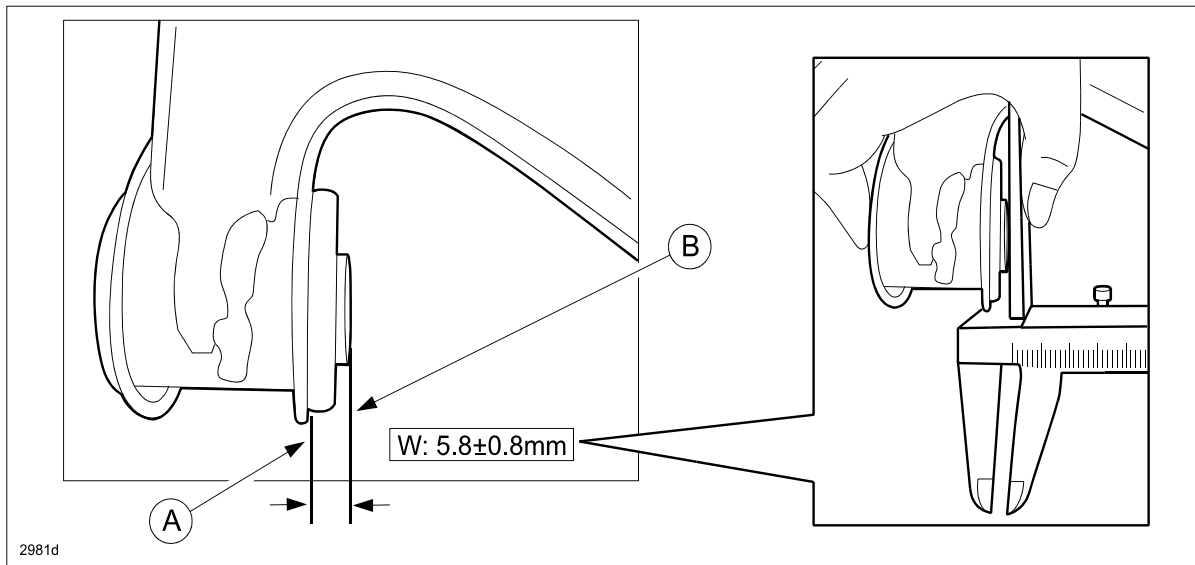

8. Reinstall the front lower control arm according to the on-line instructions on MS3 or the Workshop Manual (section 02-13 FRONT LOWER ARM REMOVAL/INSTALLATION).
9. Perform Steps 3 - 8 on opposite side of vehicle.
10. Perform wheel alignment inspection and adjust if necessary.
11. Verify the repair.

**PART(S) INFORMATION**

Part Number	Description	Qty.	Notes
KDY5-34-470	Front Rubber Bushing	2	Repair both sides of vehicle

**WARRANTY INFORMATION**

**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under the New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

	Dealer Sublets Wheel Alignment	Dealer Performs Wheel Alignment
Warranty Type	A	A
Symptom Code	82	82
Damage Code	93	93
Part Number Main Cause	KDY5-34-470 (Lower Arm Bushing)	KDY5-34-470 (Lower Arm Bushing)
Quantity	2	2
Operation Number / Labor Hours	XXK8NARX / 0.8 Hrs. (Only replacement of front lower arm bushing)	XXK8NBRX / 1.8 Hrs. (Includes front wheel alignment check and adjust)
Sublet Code	Z9 or X	---