

TECHNICAL BULLETIN
LTB00627NAS1
04 FEB 2014



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-10

Climate Seats Inoperative

AFFECTED VEHICLE RANGE:

Range Rover Sport (LW)

Model Year: 2014

VIN: EA300000-EA336928

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The climate seats (front and/or rear) may be inoperative.

Cause: This may be caused by the ducting in the seat cushion(s) being blocked by excess foam.

Action: Should a customer express this concern, follow the Service Instruction outlined below.

PARTS:

No Parts Required

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Climate seat duct - Unblock - One front seat	78.15.89.27	0.7	42	LR042340
Climate seat duct - Unblock - Both front seats	78.15.89.29	1.3	42	LR042340
Climate seat duct - Unblock - One rear seat	78.15.89.28	0.1	42	LR042762
Climate seat duct - Unblock - Both rear seats	78.15.89.30	0.1	42	LR042762


 **NOTE: Normal Warranty policies and procedures apply.**

SERVICE INSTRUCTION:

1.  **NOTE: Do not remove the cover from the seat cushion.**

Remove the affected seat cushion (see TOPIX Workshop Manual, section 501-10).

2.  **NOTE: Front seat cushion shown; rear seat similar.**

-  **NOTE: Rear seat cushion has two holes for ducting; make sure both are clear.**

Inspect all the ducting in the seat base cushion. If the ducting is blocked by excess foam, clear the excess by hand.



E162589

3. Install the seat cushion (see TOPIX Workshop Manual, section 501-10).
4. Repeat steps 1-3 as necessary to other affected climate seat(s).