

Reference	SSM71298
Models	LR4 / L319 Range Rover Sport / L320
Title	Engine MIL & code in the range P2401-00 to P2451-00 (full list below)
Category	Engine
Last modified	07-Feb-2014 00:00:00
Symptom	404000 Fuel System Concerns
	<p><u>Issue:</u> The engine MIL is illuminated and one of the following DTC's are set: P2401-00, P2402-00, P2404-29, P2404-2F, P2405-00, P2406-00, P240A-00, P240B-00, P240C-00, P2450-00 or P2451-00</p> <p><u>Cause:</u> If no fault is found on the vehicle having followed the latest diagnostic guidance in TOPIx, the cause may be an internal DMTL pump failure.</p>
Content	<p><u>Action:</u> Please raise an EPQR providing detail of diagnostic work undertaken. Replace the DMTL pump and retain the original DMTL pump for return. The UK factory will arrange shipping of the replaced component. Parts are only required where one of the following DTC's are found: P2401-00, P2402-00, P2404-29, P2404-2F, P2405-00, P2406-00, P240A-00, P240B-00, P240C-00, P2450-00 or P2451-00</p> <p>Parts are not required from cases where only an evaporative emission code is found.</p>