| Reference | SSM71698 |
|---------------|---|
| Models | Range Rover (All New) / L405 |
| Title | Business Class Rear Seat Diagnostic Codes |
| Category | Electrical |
| Last modified | 25-Feb-2014 00:00:00 |
| Symptom | 205000 Electrical Accessories |
| Content | Issue: False Diagnostic Trouble Code (DTC) logging of DTC B1063-31 for Rear Left Seat Module & Rear Right Seat Module on Range Rover Business Class Short Wheel Base (SWB) 'vehicles without front upper squab option' variants only, VIN 152794 onwards. Cause: Rear seat module LCF have front upper squab axis enabled however these derivatives of seats do not have front upper squab fitted. If an On Demand Self-Test (ODST) is run using Symptom Driven Diagnostics (SDD) the DTC will be set. Action: If DTC B1063-31 is set following a (ODST) routine do not continue to diagnose the concern unless the code re-appears immediately after clearing. |