

Reference	SSM71198
Models	LR2 / L359 Range Rover Evoque / L538
Title	LTB00342 technical bulletin - important information
Category	Driveline
Last modified	07-Mar-2014 00:00:00
Symptom	509000 Axle Concerns
Content	<p>Issue: Warranty claims and EPQR have been received where technical bulletin LTB00342 has been completed on vehicles outside the VIN range in the bulletin. There is also evidence that the bulletin has been completed on Evoque. Special Service Messages 46477, 54417 and 55837 also refer to LTB00342.</p> <p>Action: The repair outlined in LTB00342 (currently at version 2) must only be completed on Freelander 2 (LR2) within the bulletin VIN range 000212 to 257090. At VIN 257091 an improved pinion bearing design was introduced along with a design change to the differential.</p> <p>The bearing kit in the bulletin is not compatible with LR2 / Freelander 2 from VIN 257091, and is not compatible with Evoque. The bearings are different sizes and will not fit correctly. For vehicles not covered by LTB00342, the correct repair for a pinion bearing failure is to replace the differential assembly.</p>