

Reference	SSM71862
Models	LR4 / L319 Range Rover / L405 Range Rover Sport / L494 Defender / L316 Range Rover Evoque / L538
Title	Instrument Pack Lower level Assembly Lens Replacement
Category	Body
Last modified	24-Sep-2014 00:00:00
Symptom	107000 Interior Trim
Attachments	
Content	Issue: Customer complains of damage/markings on the surface of the vehicle's instrument pack lens. Cause: Damage/markings caused by object impact against the lens. Staining/discoloration contamination caused by using any type of cleaning product on lens. Important: Owners Handbook specifies to clean with a lightly moistened cloth and do not use chemical agents or domestic cleaners Action Where a customer concern is reported, please order the Lens Kit for the relevant model Part Number Model LR038299 – L316 7A732615 Onwards LR041042 – L319 AA000001 Onwards LR048302 – L538 CA600000 Onwards LR048302 – L494 EA300001 Onwards – Low Line Instrument Pack LR059859 – L405 13/14MY DA100001 – A130415 – High Line + No side Clips LR063634 - L405 14MY 130416 onwards - High Line + side clips Please refer to Topix Procedure: Service; Workshop Information; Workshop Manual; Workshop manual Vehicle Model, 4: Electrical; 413: Instrumentation and Warning Systems; 413-01 Instrument Cluster; Removal and Installation - Instrument Cluster Lens. Note; Any marks or damage identified following PDI are not covered by warranty.