

TECHNICAL BULLETIN  
LTB00687NAS2  
17 OCT 2014



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

**This reissue replaces all previous versions. Please destroy all previous versions.**

Changes are highlighted in gray

**SECTION: 204-01**

'Creak' Noise From Stabilizer Bar - Front

**AFFECTED VEHICLE RANGE:**

**Range Rover Evoque (LV)**

**Model Year:** 2012-2013

**VIN:** CH000447-DH958173

**MARKETS:**

NAS

**CONDITION SUMMARY:**

**Situation:** A 'creak' noise from the front suspension stabilizer bar may be evident when traveling over speed bumps or on rough roads for a short period of time at lower ambient temperatures.



**NOTE:** This issue is very rarely seen outside of the central and northern European markets.

**Cause:** This may be caused by manufacturing bush lubrication and material properties affecting a small number of vehicles due to climatic conditions and excessive bush lubricant being applied during vehicle build.

**Action:** Should a customer express this concern, follow the Service Instruction outlined below.

**PARTS:**

LR030743      Front stabilizer bar bushes      Quantity: 2

**TOOLS:**

Refer to Workshop Manual for any required special tools.

**WARRANTY:**



**NOTE:** Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.



**NOTE:** DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Bush - Stabilizer bar - Front - Pair - Renew	60.10.05	0.6	12	LR030743



**NOTE:** Normal Warranty procedures apply.

**SERVICE INSTRUCTION:**



**CAUTION: Do not lubricate the bushes in an attempt to cure the noise.**



**CAUTION: The stabilizer bar must be cleaned off using a suitable degreasing cloth prior to the new bushes being fitted.**

1. Replace the front suspension stabilizer bushes, (see TOPIX Workshop Manual, section 204-01).