

Reference	SSM71994
Models	Range Rover Evoque / L538
Title	9hp transmission. P0795, P07E3, P0893 faults
Category	Driveline
Last modified	07-Nov-2014 00:00:00
Symptom	504000 Other Automatic Transmission Concerns
Attachments	
Content	<p>Issue: A small volume of 14 & 15 MY Evoque (L538) are flagging the the following DTC codes - P0795-04 or P07E3-07 or P0893-07 which are related to the 9HP48 automatic transmission.</p> <p>Cause: Internal transmission diagnostics have been triggered - issues now resolved.</p> <p>Action: Update the Transmission Control Module (TCM) software to the latest available version. (versions at or above the software numbers listed below) Once updated, retest and if DTC does not occur again release to customer. If DTC captured again, please follow standard diagnosis procedures and refer to TOPIx instructions.</p> <p>(Further action post software update if applicable)</p> <p>Run the transmission adaption procedure which can be located by following symptom path below:</p> <p>Menu on SDD: Selected symptoms path: Powertrain, Auto transmission and trans – axle, Auto transmission and trans - axle symptoms, Harsh shift, Click continue, Recommendations.</p> <p>Software Level: EJ32-14C337-CBM.vbf..... DW12 AD EJ32-14C337-CDJ.vbf.....DW12 ED EJ32-14C337-CAM.vbf.....GTDi AD EJ32-14C337-CCJ.vbf.....GTDi ED</p>