

	GROUP Electrical	MODEL 2012~2013MY Optima (QF/TF)
	NUMBER PS422	DATE July 2015
 		
SUBJECT: ABS HECU REPLACEMENT DUE TO HESITATION CONCERNS		

When addressing customer concerns regarding hesitation from the vehicle on hard acceleration, test drive the vehicle to verify the concern. Prior to test driving the vehicle, eliminate common Electronic Stability Control (ESC) trigger factors such as excessive or unevenly worn tires and slippery road conditions. If during hard acceleration testing the ESC light illuminates on the dash and abnormal hesitation is experienced, replace the ABS Hydraulic Electronic Control Unit (HECU) with a module containing the latest S/W version, as shown in the table and image below. **NOTE: always verify latest applicable P/N information using EPC.**

Configuration	Part Number	Old S/W Version	New S/W Version
ABS HECU w/o EPB equipped	58920 2T550	1.4	1.5
ABS HECU with EPB equipped (SXL only)	58920 4C550	1.6	1.7

