



TECH TIP: DTC C1203 or C1212 - Speed Sensor Failure

NUMBER: TT066

MODEL: 2015MY OPTIMA (TF/QF)

DATE: 05/14/2015

Symptom: C1203 – RH Front Wheel Speed Sensor Open/Short and/or C1212 – Vehicle Speed Sensor Failure.

Repair: Check for a short in the main ESC harness near the radiator bracket. Verify possible rubbing between the bracket that runs under the headlight to the radiator and the harness (see image). Repair the damaged wires and add insulation to the bracket to prevent any further damage to the harness. Clear any DTCs (in active or history).



Note: Tech Tips are not a substitute for proper diagnosis.